

AD-A194 724

HALL ARMOR PULLOUT TESTING(U) ARMY ENGINEER WATERWAYS
EXPERIMENT STATION UICKSBURG MS STRUCTURES LAB
W E McDONALD APA 88 WES/AF/SL-88-3

1/1

UNCLASSIFIED

F/G 13/3

NL

END

DATE

FILMED

8 88

DTIC



1-C

2-8

2-5

3-15

2-2

3-5

2-0

4-0

1-8

4-5




1-1

1-25

1-4

1-6



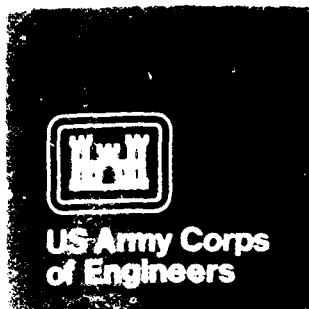

DTIC FILE COPY

(2)

WALL ARMOR PULLOUT TESTING


AD-A194 724

WALL ARMOR PULLOUT TESTING

Structural Laboratory

DEPARTMENT OF THE ARMY
CONSTRUCTION ENGINEERING CENTER
FORT BELVOIR, VIRGINIA

DTIC
ELECTE
MAY 11 1988
S D

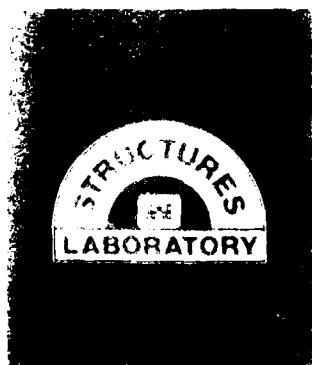

88 5 11 073

Unclassified
SECURITY CLASSIFICATION OF THIS PAGE

REPORT DOCUMENTATION PAGE				Form Approved OMB No 0704-0188 Exp Date Jun 30, 1986	
1a REPORT SECURITY CLASSIFICATION Unclassified			1b RESTRICTIVE MARKINGS		
2a SECURITY CLASSIFICATION AUTHORITY			3 DISTRIBUTION/AVAILABILITY OF REPORT		
2b DECLASSIFICATION/DOWNGRADING SCHEDULE			Approved for public release; distribution unlimited.		
4 PERFORMING ORGANIZATION REPORT NUMBER(S) Miscellaneous Paper SL-88-5			5 MONITORING ORGANIZATION REPORT NUMBER(S)		
6a NAME OF PERFORMING ORGANIZATION USAEWES Structures Laboratory		6b OFFICE SYMBOL (if applicable)	7a NAME OF MONITORING ORGANIZATION		
6c ADDRESS (City, State, and ZIP Code) PO Box 631 Vicksburg, MS 39180-0631			7b ADDRESS (City, State, and ZIP Code)		
8a NAME OF FUNDING/SPONSORING ORGANIZATION US Army Engineer District, St. Louis		8b OFFICE SYMBOL (if applicable)	9 PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER		
8c ADDRESS (City, State, and ZIP Code) St. Louis, MO 63101-1986			10 SOURCE OF FUNDING NUMBERS		
			PROGRAM ELEMENT NO	PROJECT NO	TASK NO
					WORK UNIT ACCESSION NO
11 TITLE (Include Security Classification) Wall Armor Pullout Testing					
12 PERSONAL AUTHOR(S) McDonald, Willie E.					
13a TYPE OF REPORT Final report		13b TIME COVERED FROM _____ TO _____		14 DATE OF REPORT (Year, Month, Day) April 1988	
15 PAGE COUNT 40					
16 SUPPLEMENTARY NOTATION Available from National Technical Information Service, 5285 Port Royal Road, Springfield, VA 22161.					
17 COSAT CODES			18 SUBJECT TERMS (Continue on reverse if necessary and identify by block number)		
FIELD			SUB-GROUP		
GROUP					
			See reverse.		
19 ABSTRACT (Continue on reverse if necessary and identify by block number) This report is the result of a full-scale pullout test program performed for the purpose of providing comparative data on the pullout resistance of headed stud versus anchor strap designs of wall armor assemblies used in concrete locks. A total of eight wall armor assemblies were fabricated and embedded into concrete specimens during this test program. Thirteen pullout tests were performed with the two different designs of wall armor assemblies. The anchor strap designs exhibited the highest pullout resistance. Test results indicated that the anchor strap assemblies distributed stress over larger areas of the concrete specimens, thereby resisting greater loadings.)					
20 DISTRIBUTION AVAILABILITY OF ABSTRACT <input checked="" type="checkbox"/> UNCLASSIFIED/UNLIMITED <input type="checkbox"/> SAME AS RPT <input type="checkbox"/> DTIC USERS			21 ABSTRACT SECURITY CLASSIFICATION Unclassified		
22a NAME OF RESPONSIBLE INDIVIDUAL			22b TELEPHONE (Include Area Code)		22c OFFICE SYMBOL

DD FORM 1473, 84 MAR

83 APR edition may be used until exhausted
All other editions are obsolete

SECURITY CLASSIFICATION OF THIS PAGE

Unclassified

Unclassified

SECURITY CLASSIFICATION OF THIS PAGE

18. SUBJECT TERMS (Continued).

Anchor straps,
Boundaries (failure)
Cracking
Deterioration
Failure cone

Headed studs
Lockwall armor assemblies
Pullout resistance
Rupture
Tensile testing

Unclassified

SECURITY CLASSIFICATION OF THIS PAGE

PREFACE

The investigation described in this report was conducted for the US Army Engineer District, St. Louis (LMS), by the Concrete Technology Division (CTD) of the Structures Laboratory (SL), US Army Engineer Waterways Experiment Station (WES). Authorization for this investigation was given by DA Form 2544, ED85-35, dated 26 February 1985.

This investigation was performed at WES under the general supervision of Mr. Bryant Mather, Chief, SL; Mr. John M. Scanlon, Jr., Chief, CTD; Mr. Henry Thornton, Chief, Evaluation and Monitoring Unit (E&MU); and under the direct supervision of Mr. Willie E. McDonald, E&MU, principal investigator; and Mr. Edward F. O'Neil III, E&MU, senior advisor. Messrs. Frank W. Dorsey and Dan E. Wilson, E&MU, assisted in preparation of the concrete test specimens and setup of instrumentation. The Welding Shop, Construction Services, at WES fabricated the wall armor assemblies. Messrs. McDonald and O'Neil conducted the pullout tests. Mr. Thomas J. Leicht served as point of contact at LMS and provided helpful insights during the investigation. This report was written by Mr. McDonald with Mr. O'Neil assisting in preparation of the final version.

COL Dwayne G. Lee is the Commander and Director of WES and Dr. Robert W. Whalin is Technical Director.



NO. 1	FOR
NO. 2	CHAI
NO. 3	TAH
NO. 4	101
NO. 5	101
NO. 6	101
NO. 7	101
NO. 8	101
NO. 9	101
NO. 10	101
NO. 11	101
NO. 12	101
NO. 13	101
NO. 14	101
NO. 15	101
NO. 16	101
NO. 17	101
NO. 18	101
NO. 19	101
NO. 20	101
NO. 21	101
NO. 22	101
NO. 23	101
NO. 24	101
NO. 25	101
NO. 26	101
NO. 27	101
NO. 28	101
NO. 29	101
NO. 30	101
NO. 31	101
NO. 32	101
NO. 33	101
NO. 34	101
NO. 35	101
NO. 36	101
NO. 37	101
NO. 38	101
NO. 39	101
NO. 40	101
NO. 41	101
NO. 42	101
NO. 43	101
NO. 44	101
NO. 45	101
NO. 46	101
NO. 47	101
NO. 48	101
NO. 49	101
NO. 50	101
NO. 51	101
NO. 52	101
NO. 53	101
NO. 54	101
NO. 55	101
NO. 56	101
NO. 57	101
NO. 58	101
NO. 59	101
NO. 60	101
NO. 61	101
NO. 62	101
NO. 63	101
NO. 64	101
NO. 65	101
NO. 66	101
NO. 67	101
NO. 68	101
NO. 69	101
NO. 70	101
NO. 71	101
NO. 72	101
NO. 73	101
NO. 74	101
NO. 75	101
NO. 76	101
NO. 77	101
NO. 78	101
NO. 79	101
NO. 80	101
NO. 81	101
NO. 82	101
NO. 83	101
NO. 84	101
NO. 85	101
NO. 86	101
NO. 87	101
NO. 88	101
NO. 89	101
NO. 90	101
NO. 91	101
NO. 92	101
NO. 93	101
NO. 94	101
NO. 95	101
NO. 96	101
NO. 97	101
NO. 98	101
NO. 99	101
NO. 100	101
NO. 101	101
NO. 102	101
NO. 103	101
NO. 104	101
NO. 105	101
NO. 106	101
NO. 107	101
NO. 108	101
NO. 109	101
NO. 110	101
NO. 111	101
NO. 112	101
NO. 113	101
NO. 114	101
NO. 115	101
NO. 116	101
NO. 117	101
NO. 118	101
NO. 119	101
NO. 120	101
NO. 121	101
NO. 122	101
NO. 123	101
NO. 124	101
NO. 125	101
NO. 126	101
NO. 127	101
NO. 128	101
NO. 129	101
NO. 130	101
NO. 131	101
NO. 132	101
NO. 133	101
NO. 134	101
NO. 135	101
NO. 136	101
NO. 137	101
NO. 138	101
NO. 139	101
NO. 140	101
NO. 141	101
NO. 142	101
NO. 143	101
NO. 144	101
NO. 145	101
NO. 146	101
NO. 147	101
NO. 148	101
NO. 149	101
NO. 150	101
NO. 151	101
NO. 152	101
NO. 153	101
NO. 154	101
NO. 155	101
NO. 156	101
NO. 157	101
NO. 158	101
NO. 159	101
NO. 160	101
NO. 161	101
NO. 162	101
NO. 163	101
NO. 164	101
NO. 165	101
NO. 166	101
NO. 167	101
NO. 168	101
NO. 169	101
NO. 170	101
NO. 171	101
NO. 172	101
NO. 173	101
NO. 174	101
NO. 175	101
NO. 176	101
NO. 177	101
NO. 178	101
NO. 179	101
NO. 180	101
NO. 181	101
NO. 182	101
NO. 183	101
NO. 184	101
NO. 185	101
NO. 186	101
NO. 187	101
NO. 188	101
NO. 189	101
NO. 190	101
NO. 191	101
NO. 192	101
NO. 193	101
NO. 194	101
NO. 195	101
NO. 196	101
NO. 197	101
NO. 198	101
NO. 199	101
NO. 200	101
NO. 201	101
NO. 202	101
NO. 203	101
NO. 204	101
NO. 205	101
NO. 206	101
NO. 207	101
NO. 208	101
NO. 209	101
NO. 210	101
NO. 211	101
NO. 212	101
NO. 213	101
NO. 214	101
NO. 215	101
NO. 216	101
NO. 217	101
NO. 218	101
NO. 219	101
NO. 220	101
NO. 221	101
NO. 222	101
NO. 223	101
NO. 224	101
NO. 225	101
NO. 226	101
NO. 227	101
NO. 228	101
NO. 229	101
NO. 230	101
NO. 231	101
NO. 232	101
NO. 233	101
NO. 234	101
NO. 235	101
NO. 236	101
NO. 237	101
NO. 238	101
NO. 239	101
NO. 240	101
NO. 241	101
NO. 242	101
NO. 243	101
NO. 244	101
NO. 245	101
NO. 246	101
NO. 247	101
NO. 248	101
NO. 249	101
NO. 250	101
NO. 251	101
NO. 252	101
NO. 253	101
NO. 254	101
NO. 255	101
NO. 256	101
NO. 257	101
NO. 258	101
NO. 259	101
NO. 260	101
NO. 261	101
NO. 262	101
NO. 263	101
NO. 264	101
NO. 265	101
NO. 266	101
NO. 267	101
NO. 268	101
NO. 269	101
NO. 270	101
NO. 271	101
NO. 272	101
NO. 273	101
NO. 274	101
NO. 275	101
NO. 276	101
NO. 277	101
NO. 278	101
NO. 279	101
NO. 280	101
NO. 281	101
NO. 282	101
NO. 283	101
NO. 284	101
NO. 285	101
NO. 286	101
NO. 287	101
NO. 288	101
NO. 289	101
NO. 290	101
NO. 291	101
NO. 292	101
NO. 293	101
NO. 294	101
NO. 295	101
NO. 296	101
NO. 297	101
NO. 298	101
NO. 299	101
NO. 300	101
NO. 301	101
NO. 302	101
NO. 303	101
NO. 304	101
NO. 305	101
NO. 306	101
NO. 307	101
NO. 308	101
NO. 309	101
NO. 310	101
NO. 311	101
NO. 312	101
NO. 313	101
NO. 314	101
NO. 315	101
NO. 316	101
NO. 317	101
NO. 318	101
NO. 319	101
NO. 320	101
NO. 321	101
NO. 322	101
NO. 323	101
NO. 324	101
NO. 325	101
NO. 326	101
NO. 327	101
NO. 328	101
NO. 329	101
NO. 330	101
NO. 331	101
NO. 332	101
NO. 333	101
NO. 334	101
NO. 335	101
NO. 336	101
NO. 337	101
NO. 338	101
NO. 339	101
NO. 340	101
NO. 341	101
NO. 342	101
NO. 343	101
NO. 344	101
NO. 345	101
NO. 346	101
NO. 347	101
NO. 348	101
NO. 349	101
NO. 350	101
NO. 351	101
NO. 352	101
NO. 353	101
NO. 354	101
NO. 355	101
NO. 356	101
NO. 357	101
NO. 358	101
NO. 359	101
NO. 360	101
NO. 361	101
NO. 362	101
NO. 363	101
NO. 364	101
NO. 365	101
NO. 366	101
NO. 367	101
NO. 368	101
NO. 369	101
NO. 370	101
NO. 371	101
NO. 372	101
NO. 373	101
NO. 374	101
NO. 375	101
NO. 376	101
NO. 377	101
NO. 378	101
NO. 379	101
NO. 380	101
NO. 381	101
NO. 382	101
NO. 383	101
NO. 384	101
NO. 385	101
NO. 386	101
NO. 387	101
NO. 388	101
NO. 389	101
NO. 390	101
NO. 391	101
NO. 392	101
NO. 393	101
NO. 394	101
NO. 395	101
NO. 396	101
NO. 397	101
NO. 398	101
NO. 399	101
NO. 400	101
NO. 401	101
NO. 402	101
NO. 403	101
NO. 404	101
NO. 405	101
NO. 406	101
NO. 407	101
NO. 408	101
NO. 409	101
NO. 410	101
NO. 411	101
NO. 412	101
NO. 413	101
NO. 414	101
NO. 415	101
NO. 416	101
NO. 417	101
NO. 418	101
NO. 419	101
NO. 420	101
NO. 421	101
NO. 422	101
NO. 423	101
NO. 424	101
NO. 425	101
NO. 426	101
NO. 427	101
NO. 428	101
NO. 429	101
NO. 430	101
NO. 431	101
NO. 432	101
NO. 433	101
NO. 434	101
NO. 435	101
NO. 436	101
NO. 437	101
NO. 438	101
NO. 439	101
NO. 440	101
NO. 441	101
NO. 442	101
NO. 443	101
NO. 444	101
NO. 445	101
NO. 446	101
NO. 447	101
NO. 448	101
NO. 449	101
NO. 450	101
NO. 451	101
NO. 452	101
NO. 453	101
NO. 454	101
NO. 455	101
NO. 456	101
NO. 457	101
NO. 458	101
NO. 459	101
NO. 460	101
NO. 461	101
NO. 462	101
NO. 463	101
NO. 464	101
NO. 465	101
NO. 466	101
NO. 467	101
NO. 468	101
NO. 469	101
NO. 470	101
NO. 471	101
NO. 472	101
NO. 473	101
NO. 474	101
NO. 475	101
NO. 476	101
NO. 477	101
NO. 478	101
NO. 479	101
NO. 480	101
NO. 481	101
NO. 482	101
NO. 483	101
NO. 484	101
NO. 485	101
NO. 486	101
NO. 487	101
NO. 488	101
NO. 489	101
NO. 490	101
NO. 491	101
NO. 492	101
NO. 493	101
NO. 494	101
NO. 495	101
NO. 496	101
NO. 497	101
NO. 498	101
NO. 499	101
NO. 500	101
NO. 501	101
NO. 502	101
NO. 503	101
NO. 504	101
NO. 505	101
NO. 506	101
NO. 507	101
NO. 508	101
NO. 509	101
NO. 510	101
NO. 511	101
NO. 512	101
NO. 513	101
NO. 514	101
NO. 515	101
NO. 516	101
NO. 517	101
NO. 518	101
NO. 519	101

CONTENTS

	<u>Page</u>
PREFACE.....	1
CONVERSION FACTORS, NON-SI TO SI (METRIC) UNITS OF MEASUREMENT.....	3
PART I: INTRODUCTION.....	4
Background.....	4
Failure Mode Theory.....	4
PART II: ARMOR ASSEMBLIES.....	5
Materials.....	5
Concrete Specimens.....	7
PART III: TEST PROCEDURES.....	9
Six-foot Wall Armor Assemblies.....	9
Three-foot Wall Armor Assemblies.....	9
PART IV: TEST RESULTS.....	11
Six-foot Assembly Tests.....	12
Three-foot Assembly Tests.....	13
Concrete Cylinder Tests.....	13
Discussion.....	13
PHOTOS 1-11	
PLATES 1-15	

CONVERSION FACTORS, NON-SI TO SI (METRIC)
UNITS OF MEASUREMENT

Non-SI units of measurement used in this report can be converted to SI
(metric) units as follows:

<u>Multiply</u>	<u>By</u>	<u>To Obtain</u>
degrees (angle)	0.01745329	radians
feet	0.3048	metres
inches	25.4	millimetres
kips (force)	4.448222	kilonewtons
pounds (force)	4.448222	newtons
pounds (force) per square inch	0.006894757	megapascals

WALL ARMOR PULLOUT TESTING

PART I: INTRODUCTION

Background

1. This investigation was authorized by DA Form 2544, No. ED85-35, dated 26 February 1985. The US Army Engineer District, St. Louis (LMS), requested a full-scale pullout test program be conducted by the Waterways Experiment Station (WES), Concrete Technology Division (CTD), for the purpose of providing data to compare the pullout resistance of headed stud versus anchor strap designs of wall armor assemblies. LMS is overseeing the construction of Lock and Dam No. 26 in which wall armor is embedded in lock wall monoliths to prevent damage to the concrete resulting from the impact forces of barges.

2. Presently, wall armor using the anchor strap design is being used. However, the design of wall armor using headed studs provided for more expedient field construction and is less expensive. Therefore, tests were deemed necessary to evaluate the pullout resistance of the headed stud design as compared to the anchor strap design, and to assist in analysis for possible implementation of the headed stud design.

Failure Mode Theory

3. In theory, the failure mode of the wall armor assemblies would be by "pulling out" from the monoliths by barges snagging the ends when passing, and by being caught on the top or bottom when raising or lowering the elevation of the barges in the lock chamber. As a result, testing was desired in which loading to simulate these conditions was concentrated in the respective areas. Also, because the occurrence of deterioration of concrete beneath the wall armor reduces the bonding area of the wall armor assembly, simulation of deterioration was requested to be included in the test program.

4. CTD designed and carried out this test program in support of these efforts.

PART II: ARMOR ASSEMBLIES

Materials

5. A total of eight wall armor assemblies were fabricated and embedded in concrete specimens during the test program. Typical assemblies can be seen in Figure 1, and shop drawings detailing dimensions are given in Plates 1 and 2. A summary of the fabricated assemblies is given in Table 1.

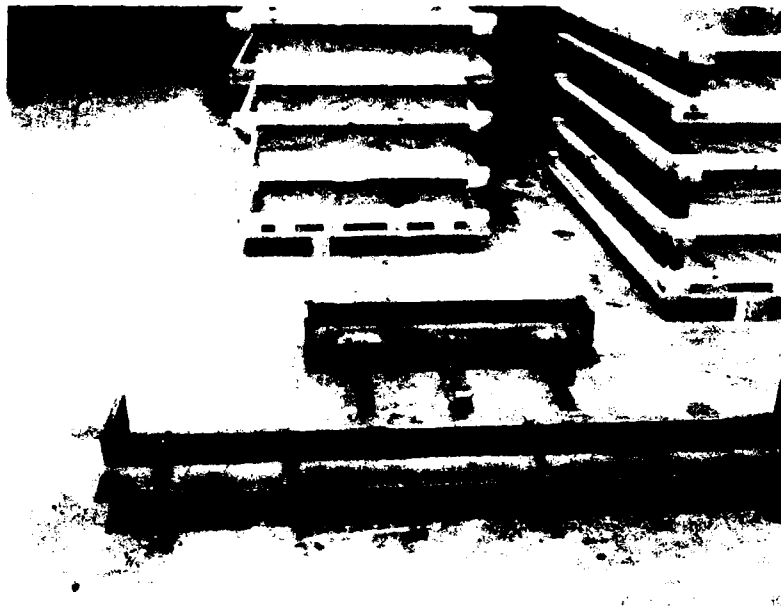


Figure 1. Typical anchor strap and headed stud wall armor assemblies

Deterioration of concrete was simulated in two of the 6-ft* wall armor assemblies by placing 1-in.-thick styrofoam beneath the flange of the wall armor to prevent concrete from filling into this area, and to simulate erosion (Figure 2).

Wall armor with anchor straps

6. There were four anchor strap assemblies fabricated from A36 steel using the design similar to that used in field construction. Two of the four were 6-ft sections, and two were 3-ft sections. The anchor straps measured

* A table of factors for converting non-SI units of measurement to SI (metric) units is presented on page 3.

Table 1
Wall Armor Assemblies

<u>Identification</u>	<u>Type</u>	<u>Length, ft</u>	<u>Description</u>	<u>Number of Tests</u>
HS6A	Headed stud	6	Without deterioration simulated	2
HS6B	Headed stud	6	With deterioration simulated	2
AS6A	Anchor strap	6	Without deterioration simulated	2
AS6B	Anchor strap	3	With deterioration simulated	2
HS3A	Headed stud	3	Without deterioration simulated	1
HS3B	Headed stud	3	Without deterioration simulated	1
AS3A	Anchor strap	3	Without deterioration simulated	1
AS3B	Anchor strap	3	Without deterioration simulated	2

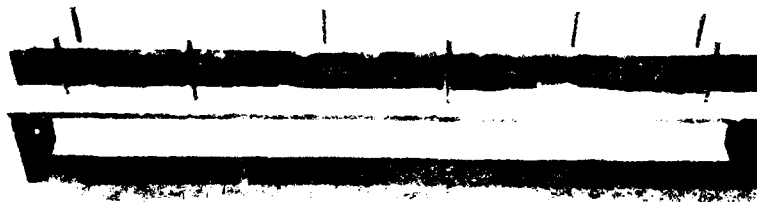


Figure 2. Placement of 1-in.-thick styrofoam beneath flange of wall armor to simulate erosion of concrete

1 ft 3-1/2 in. in length, 2 in. in width, and 1/4 in. in thickness.

Two inches from their lower ends the straps were bent to a 90-deg angle, and a length 1-1/2 in. at the opposite end was continuously welded to the web of the wall armor. The straps were welded in a staggered pattern along the length of the web 6 in. from each end and 1 ft on center.

Wall armor with headed studs

7. As with the anchor strap assemblies, there were four headed stud assemblies fabricated during the test program. Similarly, two of the four headed stud assemblies were 6-ft sections, and two were 3-ft sections. The headed studs were 3/4-in.-diam steel bars which were 8 in. long. At one end of the headed studs a 1-1/2-in.-diam, 1/2-in.-thick plate was continuously welded. The opposite ends of the headed studs were continuously welded to the flange along the length of the flange in a staggered pattern at 1-ft centers. Two headed studs were positioned on either side of the web 6 in. from each end of the assemblies.

Concrete

8. The concrete used in this test program was supplied by a local ready-mix company. The concrete was requested to provide a compressive strength of 3,000 psi in 28 days. A 1-1/2-in. maximum size limestone aggregate and a 3-in. slump were also specified.

Concrete Specimens

9. Eight concrete specimens were cast during the test program. Four of these specimens measured 2 ft 9-1/2 in. in width, 6 ft in length, and 3 ft in height. The remaining four specimens were similarly dimensioned with the exception of being 4 ft in length. In each specimen wall armor assemblies were embedded such that only the flanges of the wall armor remained exposed as shown in Figure 3. For specimen anchorage to the test floor, four 2-in.-diam steel bars, 12-3/4 in. long, were embedded to a depth of 12 in. in each of the 4-ft-long concrete specimens, 10 in. in height from the bottom of the test blocks. In the 6-ft-long concrete specimens, two 2-in.-diam bars were embedded throughout the width of the test blocks with an overhang of 5-3/4 in. on either side of the test blocks. These were also positioned 10 in. in height from the bottom of the test blocks. These bars are visible in Figure 3. Also, in each 6-ft-long concrete specimen, six No. 8 reinforcement bars were

placed in the tensile zone to resist tensile forces in the lower face of the specimen.

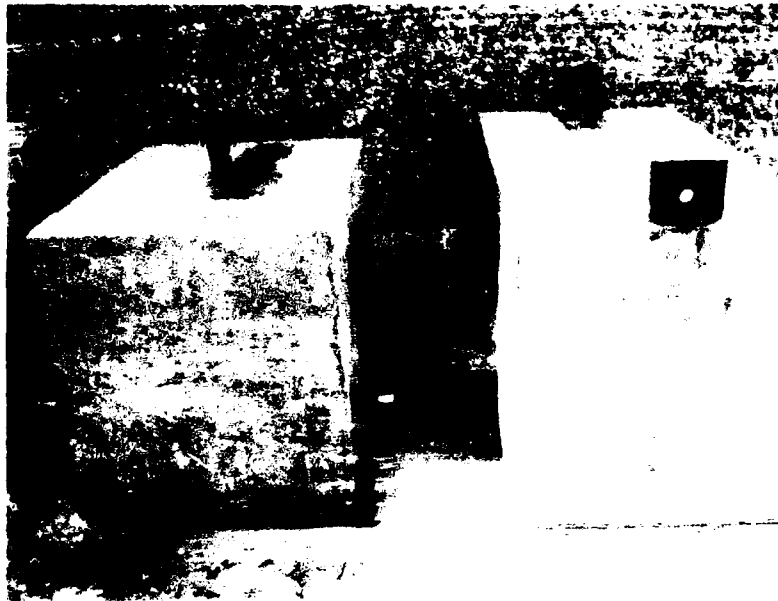



Figure 3. Wall armor assemblies embedded in concrete specimens

PART III: TEST PROCEDURES

Six-foot Wall Armor Assemblies

10. The four 6-ft assemblies were designed such that they could be tested on each end. After one end was tested, the block was rotated and tested on the opposite end. The test program was designed to perform a total of eight pullout tests on the 6-ft assemblies. Steel plate loading lugs, 7-3/4 by 7-3/4 by 3/4 in., with a 1-1/2-in.-diam hold were welded to the top of the flanges at each end to provide for loading attachments. Pullout loading of the wall armor was provided by an Instron 300,000-lb closed-loop hydraulic testing system that was attached to the foot of the actuator and the loading lugs by eyebolt and clevises (Figure 4).

Figure 4. Typical setup for testing of wall armor assemblies

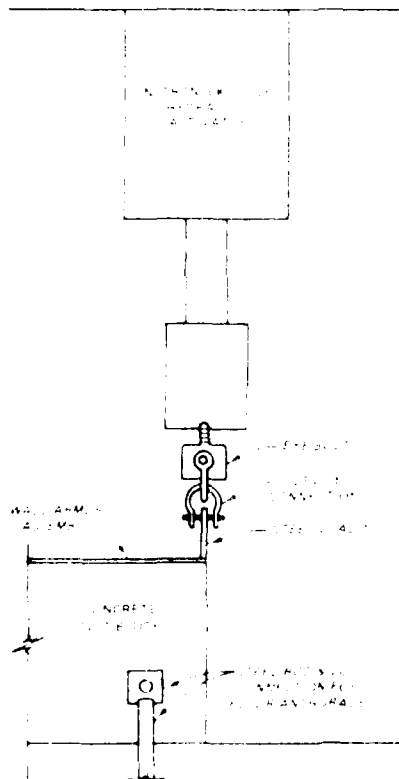

Three-foot Wall Armor Assemblies

11. The four 3-ft assemblies were tested at the center end only for a total of four pullout tests. Loading and attachments were the same as described for the 6-ft assemblies in paragraph 10.

12. The concrete test blocks were secured during testing by means of 7-1/2- by 7-1/2- by 3/4-in. steel plates welded to one end of 2-in.-diam steel rods. Two-inch-diameter holes were cut in the plates to fit on the two-inch steel bars described in paragraph 9. The 2-in.-diam steel rods were threaded on the opposite ends for bolting to the test floor.

13. The wall armor assemblies were pulled from the concrete blocks at a rate of 5,000 lbf per minute. Failure was defined by either pullout of the wall armor or by rupture of the concrete test blocks. A plot of load on the wall armor versus displacement of the actuator foot was recorded on an X-Y plotter for each test.

PART IV: TEST RESULTS

14. Throughout the test program, 13 pullout tests were performed. Of these, nine were successful by definition of failure set forth in paragraph 13. The results of these pullout tests can be seen in Table 2. Two of the three unsuccessful tests were the direct result of failure of weld joints at loadings well below what was expected. After two consecutive pullout tests resulted in weld joint failures, it was decided that 3/4-in.-thick by 4-in.-high steel stiffening members be welded along the top center of the flanges of the remaining 6-ft assemblies to distribute bending stresses over the flanges and thereby reduce the stresses on the weld joints beneath the flange (Figure 5). On the 3-ft assemblies, two stiffeners were welded across the width of the flanges in the center of the wall armor on the remaining assemblies to accomplish the same stress distribution.

Table 2
Pullout Test Results

<u>Identification</u>	<u>Load, lbf</u>	<u>Failure Mechanism</u>
HS6A-1	59,500	Rupture of concrete
HS6A-2	45,000	Rupture of weld joints
HS6B-1	59,700	Rupture of concrete
HS6B-2	62,100	Rupture of concrete
AS6A-1	82,000	Rupture of concrete
AS6A-2	65,000	Rupture of concrete
AS6B-1	76,500	Rupture of concrete
AS6B-2	64,500	Rupture of concrete
HS3A	84,500	Rupture of concrete
HS3B	78,000	Rupture of concrete
AS3A	62,000	Rupture of weld joints
AS3B-1	94,000	Failure of connection between eyebolt and actuator foot
AS3B-2	12,000	Rupture of concrete of anchor bar



Figure 5. Wall armor assembly with addition of stiffening member

Six-foot Assembly Tests

15. All of the successful tests conducted on the 6-ft assemblies failed first by producing failure cones in the concrete. Photos 1-8 show these failures. Plates 3-10 contain the raw data from the load versus deflection test plots. In the failure of the 6-ft assemblies, concrete rupture was followed by pullout of the wall armor with the exception of assembly AS6B-2. In this assembly, failure near the top surface of the concrete test block was impending (as evident by the presence of failure cracks) when rupture of the concrete occurred at the level of the anchor bar inclusion mentioned in paragraph 9. The loading range and the pattern of the failure cracks were the same as with the other 6-ft anchor strap tests at failure. Therefore, this was also considered a good test. The boundaries of the failure cones for the headed stud assemblies were at a depth close to the depth of the headed studs. For the anchor strap assemblies, the failure plane was very near the top surface of the concrete test blocks. The anchor strap wall armor tests realized the higher pullout resistance with a loading range from 64,000 to 82,000 lbf for an average of 72,000 lbf. The headed stud assemblies provided

a loading range from 59,000 to 62,000 lbf for an average of 60,433 lbf. Test(s) failing by weld joint rupture were not included in computing average values.

Three-foot Assembly Tests

16. Of the tests conducted on the 3-ft assemblies, only the two headed stud assemblies failed in a mode which was expected. Photographs of these failures are given in Photos 9-11. Raw data from load versus deflection test plots can be found in Plates 11-15. As with the 6-ft assemblies, failure of the 3-ft headed stud assemblies was the rupture of the concrete followed by pullout of the wall armor. The failure was across the top and side faces of the concrete at loadings of 84,000 and 78,700 lbf, respectively.

17. Testing of the two 3-ft anchor strap assemblies resulted in the first of the two (AS3A) failing by rupture of the weld joint between the flange and the web of the tee. There were two tests performed on the second of the two assemblies (AS3B). In the first of these two tests, loading of 94,000 lbf was attained when failure of the connection between the eyebolt and the actuator foot interrupted testing. Since no visible damage was apparent to the concrete or to the wall armor, it was retested. The second testing of this assembly resulted in rupture of the concrete in the lower plane at the depth of the anchor bar inclusion at a load of 92,000 lbf. However, failure in a mode similar to that of the 3-ft headed assemblies did not occur.

Concrete Cylinder Tests

18. The 28-day test of the concrete cylinders yielded strengths higher than the requested strength of 3,000 psi. The results can be seen in Table 3. The average 28-day strength of the concrete used in the test program was 4,990 psi.

Discussion

19. The tests performed under this test program were designed to provide relative pullout resistance comparisons between headed stud and anchor strap designs of wall armor under a given set of conditions, and therefore were not intended to be absolute pullout tests. The exception to this is that

Table 3
Concrete Compressive Strengths, 28 days

<u>Batch</u>	<u>Cylinder No.</u>	<u>Compressive Strength, psi</u>
1	5/28/85/1	4,510
	5/28/85/2	4,598
	5/28/85/3	4,704
2	6/3/85/1	4,845
	6/3/85/2	5,110
	6/3/85/3	4,898
3	6/10/85/1	5,376
	6/10/85/2	5,482
	6/10/85/3	5,447
4	6/17/85/1	4,952
	6/17/85/2	4,669
	6/17/85/3	5,235

the first two tests on the 6-ft headed stud assemblies and the first test on the 3-ft headed stud assembly were conducted without the stiffening members which were later added. However, the subsequent tests on the 6-ft headed stud assemblies with stiffeners yielded loading values in the same range as without the stiffening members. Therefore, it is believed that the addition of the stiffening members did not significantly affect the test results.

20. Given the conditions of comparing relative pullout resistance with the 6-ft wall armor, the anchor strap assemblies realized the higher pullout resistance. Using the average loading value on the headed stud assemblies of 60,433 lb as the base, the average loading value of 72,000 lbf on the anchor strap assemblies increased the pullout resistance by 19.1 percent. Also from the test results given in Table 2, the simulation of deterioration had no significant effect on the pullout resistance of the headed stud or the anchor strap wall armor.

21. Given the same conditions with the 3-ft wall armor assemblies as in paragraph 20, the anchor strap wall armor again realized the higher pullout resistance. This is because anchor strap assembly AS3B mentioned in paragraph 17 attained loading up to 94,000 lbf which was significantly larger than loading attained by either of the headed stud assemblies of 84,000 and 78,700 lbf.

22. In the case of both the end and side loading of the anchor strap and headed stud wall armor assemblies, the design of wall armor using anchor straps achieved a significantly higher pullout resistance. This would indicate that, assuming that the tensile strength of the concrete is relatively constant, the anchor strap wall armor distributed the stresses over a larger area of the concrete, and was thereby able to resist greater loadings.

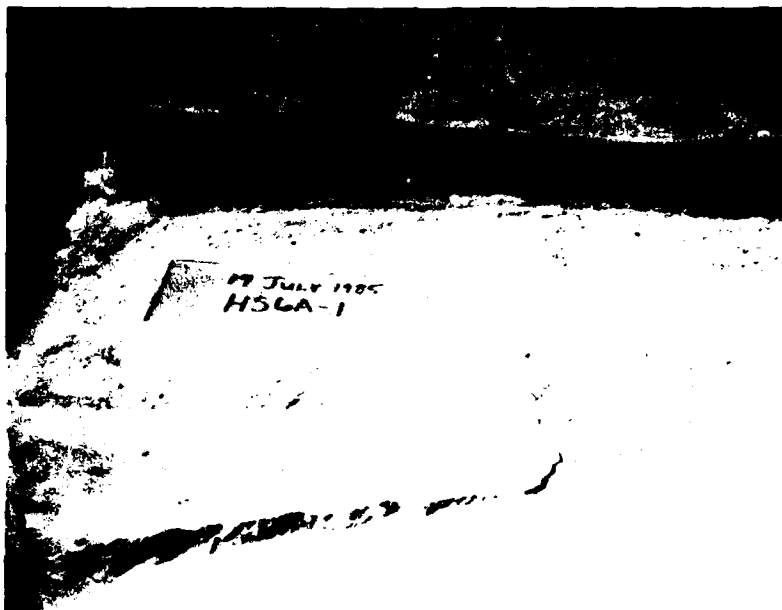


Photo 1. Wall armor test failure, assembly HS6A-1



Photo 2. Wall armor test failure, assembly HS6A-2

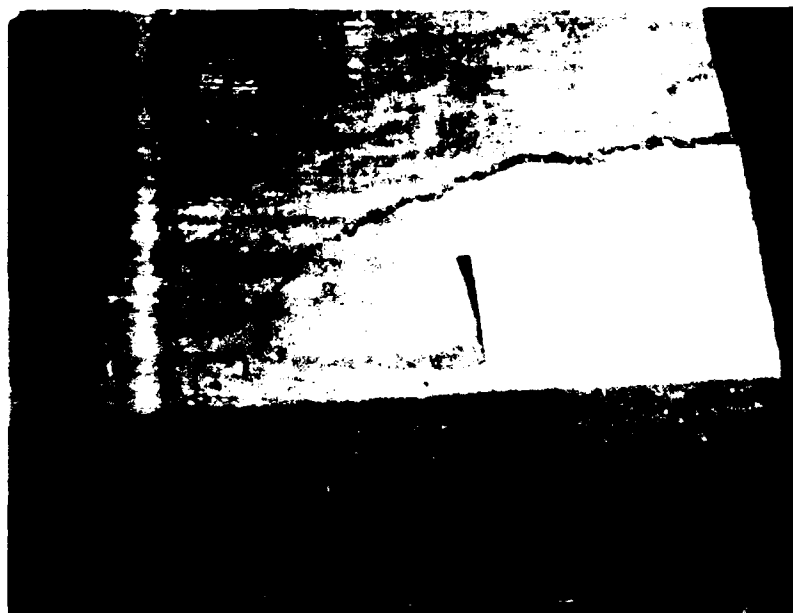


Photo 3. Wall armor test failure, assembly HS6B-1



Photo 4. Wall armor test failure, assembly HS6B-2

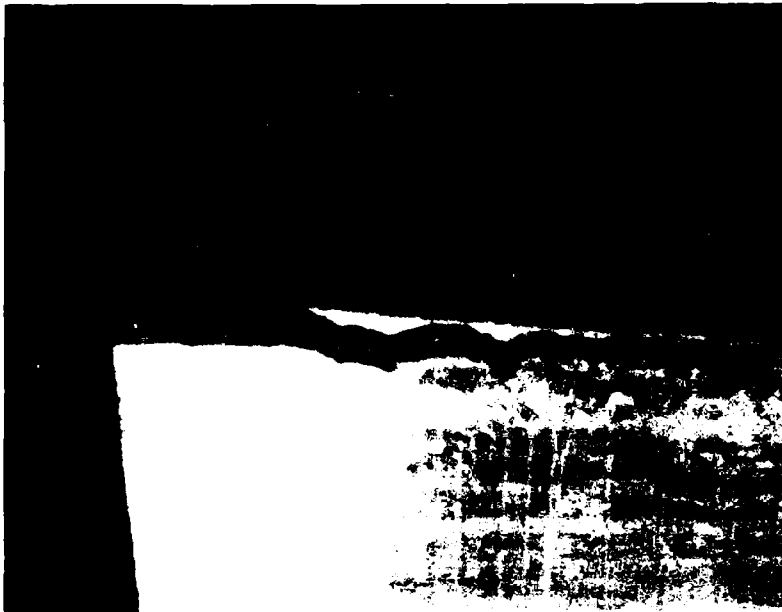


Photo 5. Wall armor test failure, assembly AS6A-1



Photo 6. Wall armor test failure, assembly AS6A-2

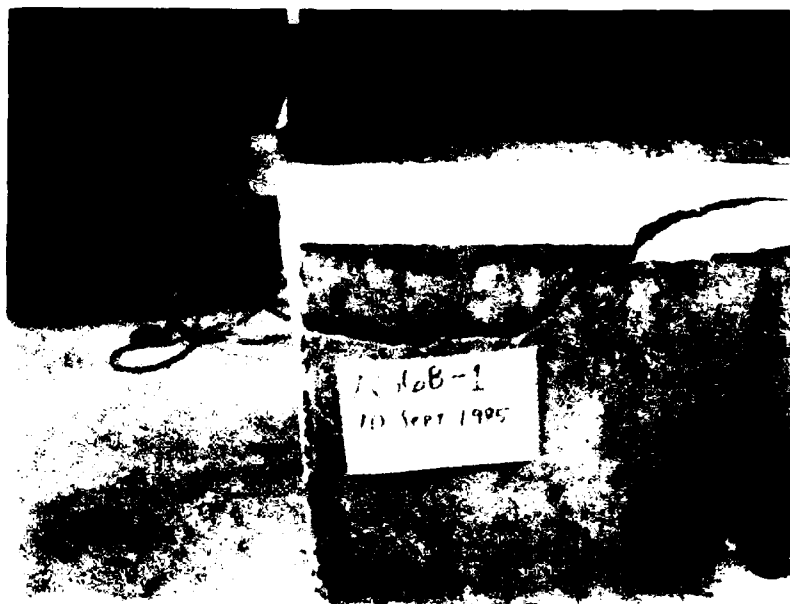


Photo 7. Wall armor test failure, assembly AS6B-1

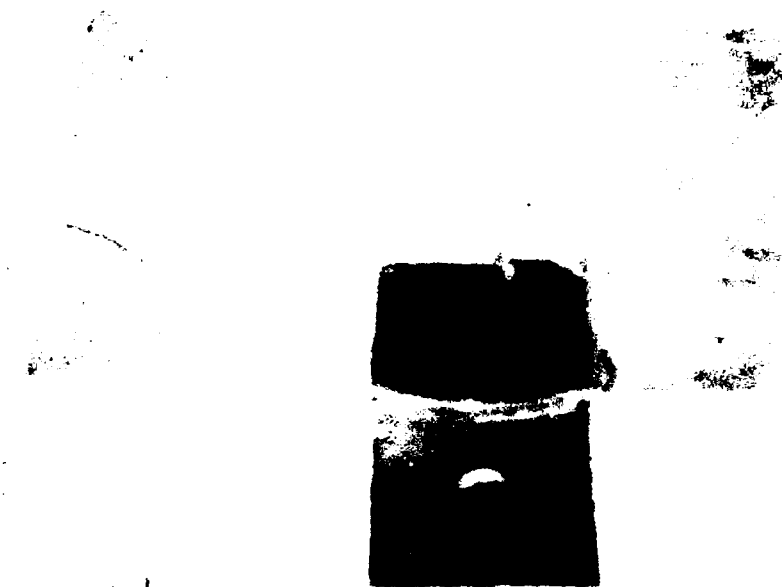


Photo 8. Wall armor test failure, assembly AS6B-2




Photo 9. Wall armor test failure, assembly HS3A






Photo 10. Wall armor test failure, assembly HS3B



Photo 11. Wall armor test failure, assembly AS3A

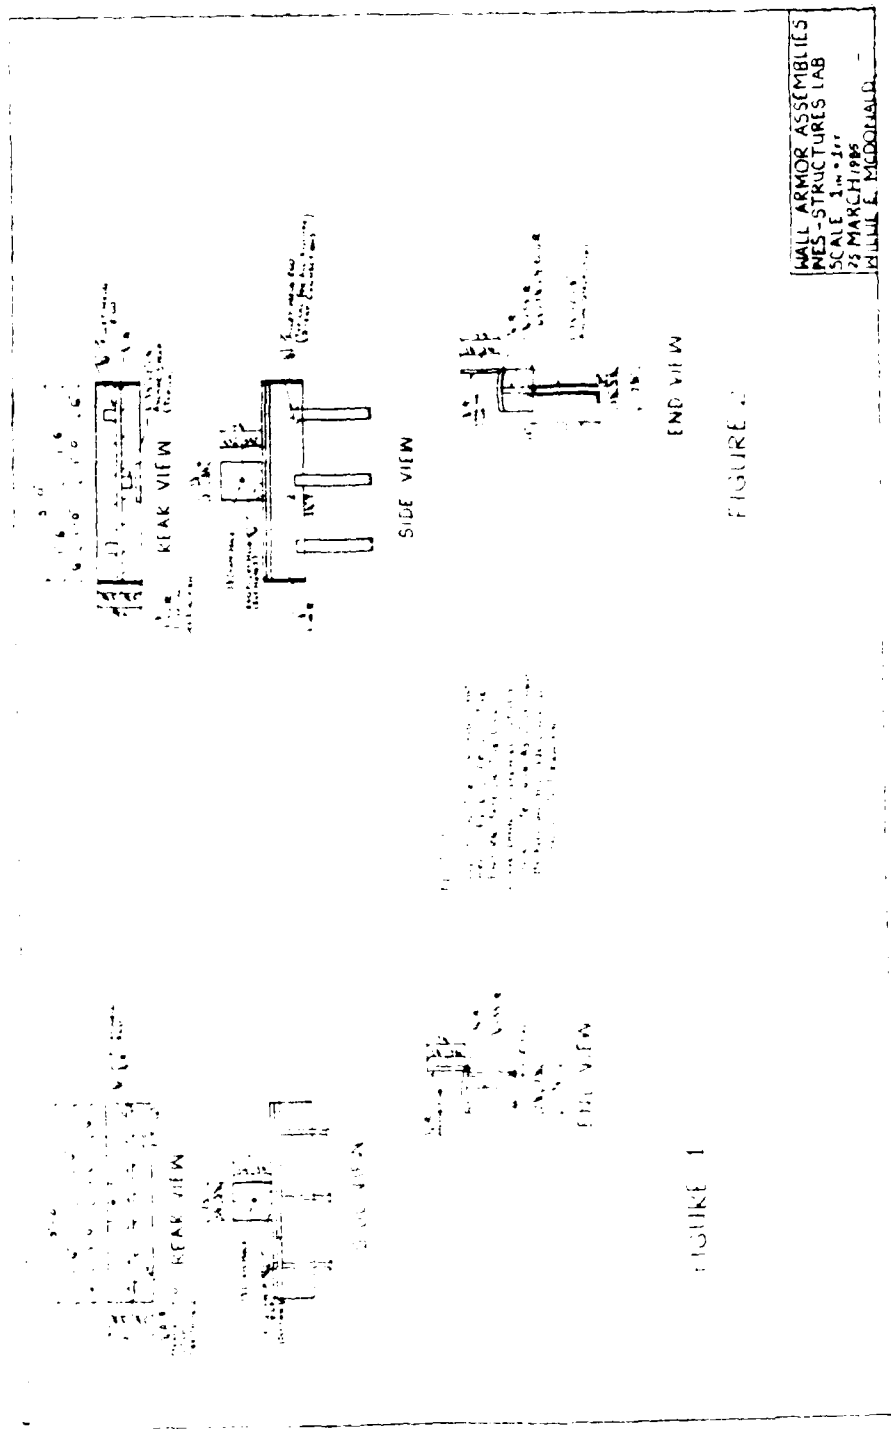

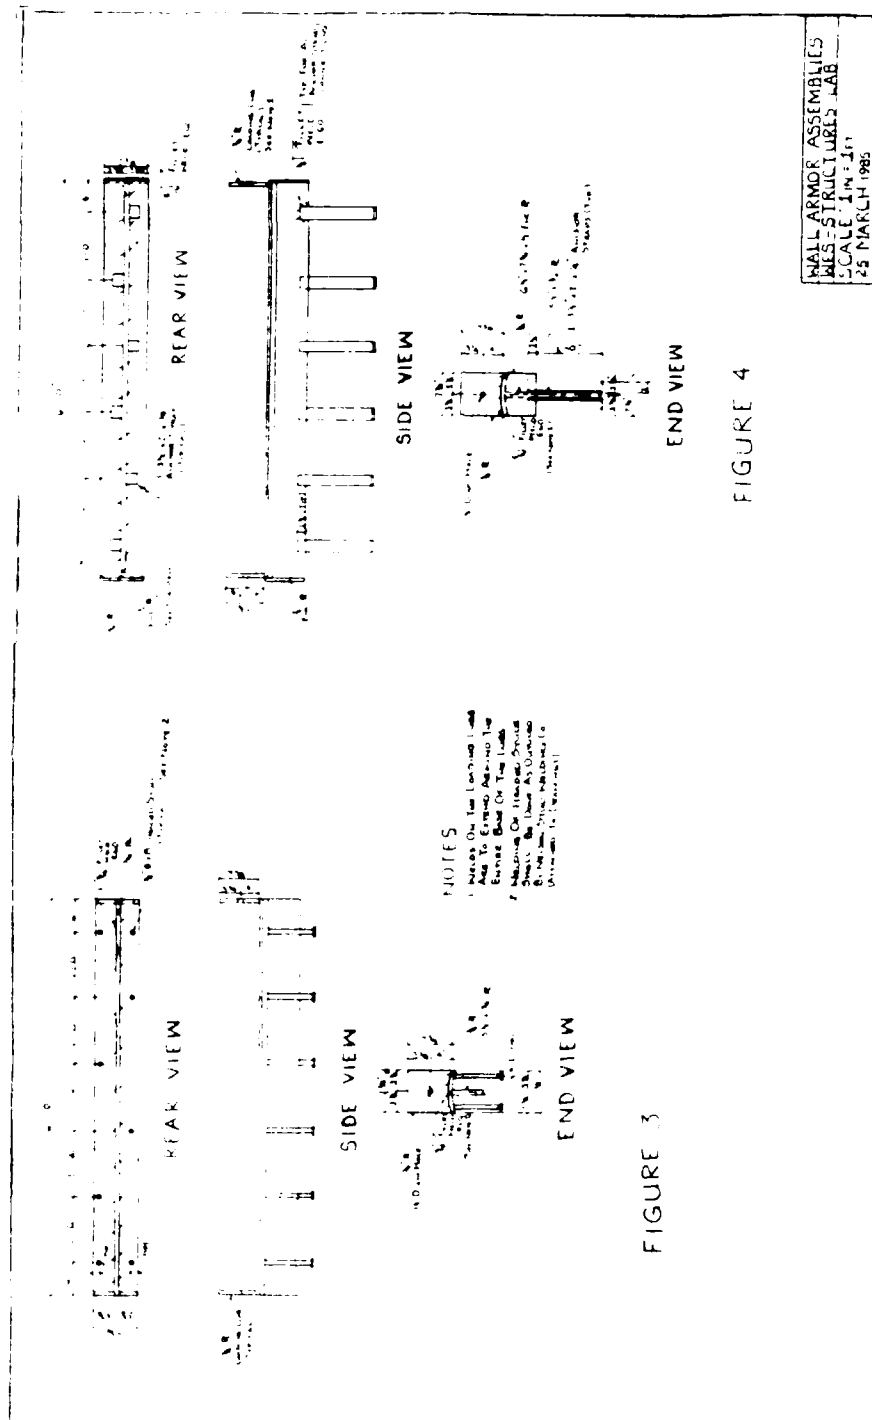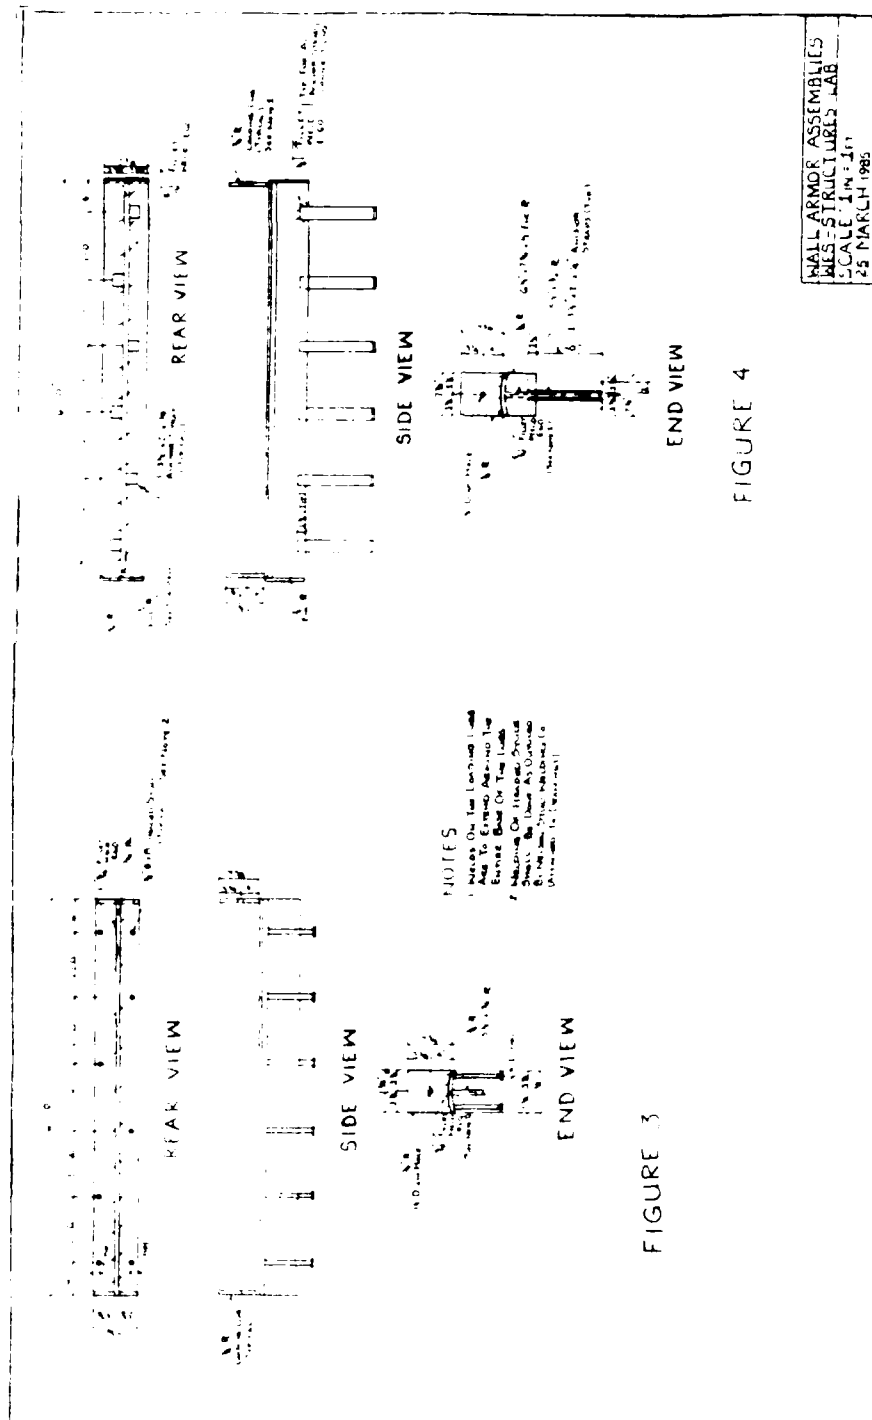

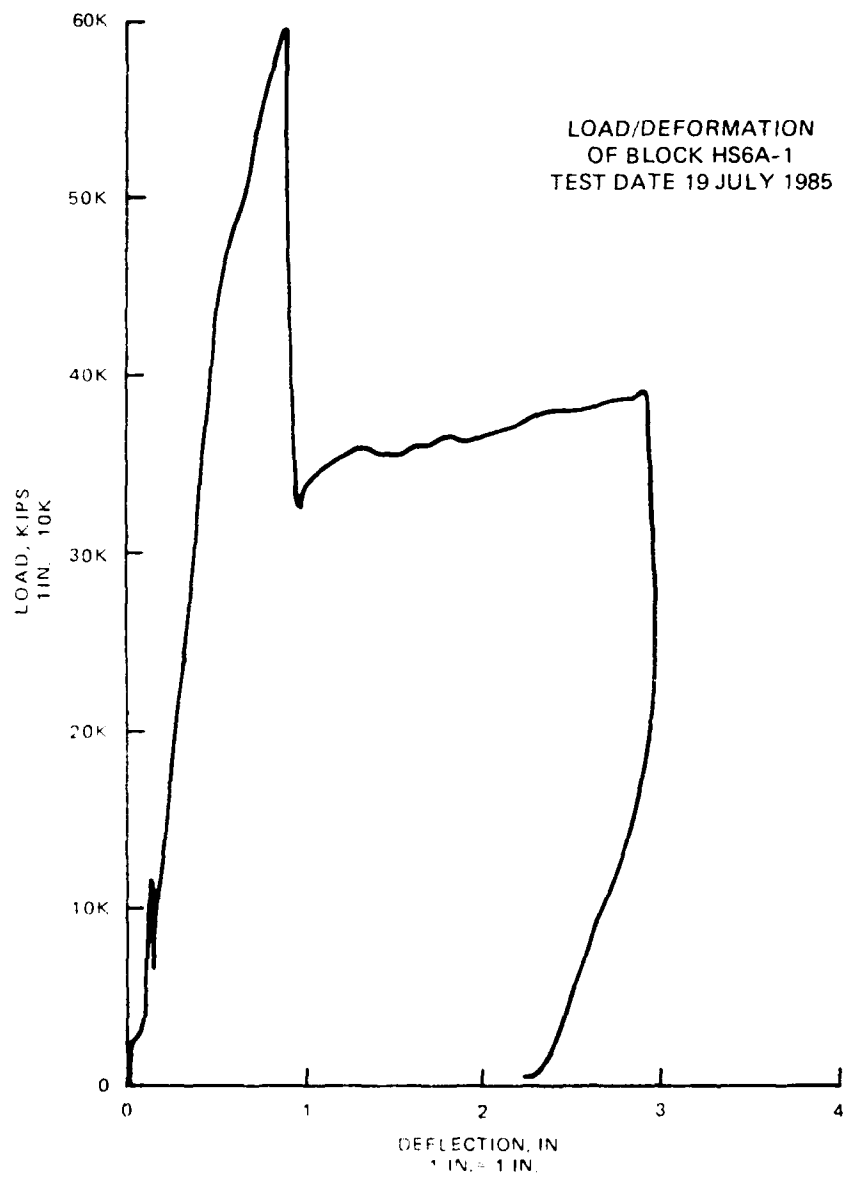

LOAD/DEFLECTION
OF BLOCK HS6A-2
TEST DATE: 19 JULY 1985

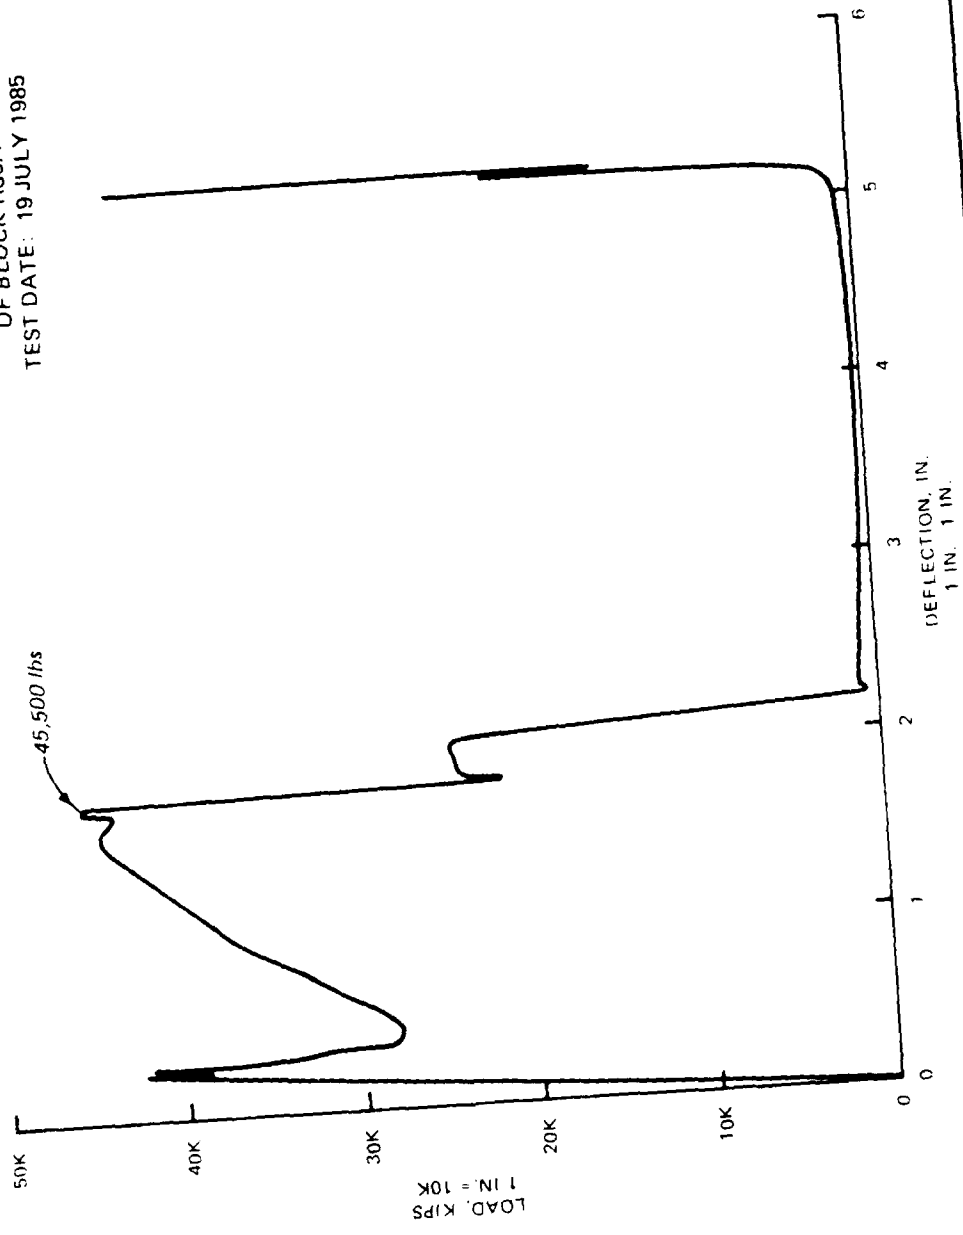
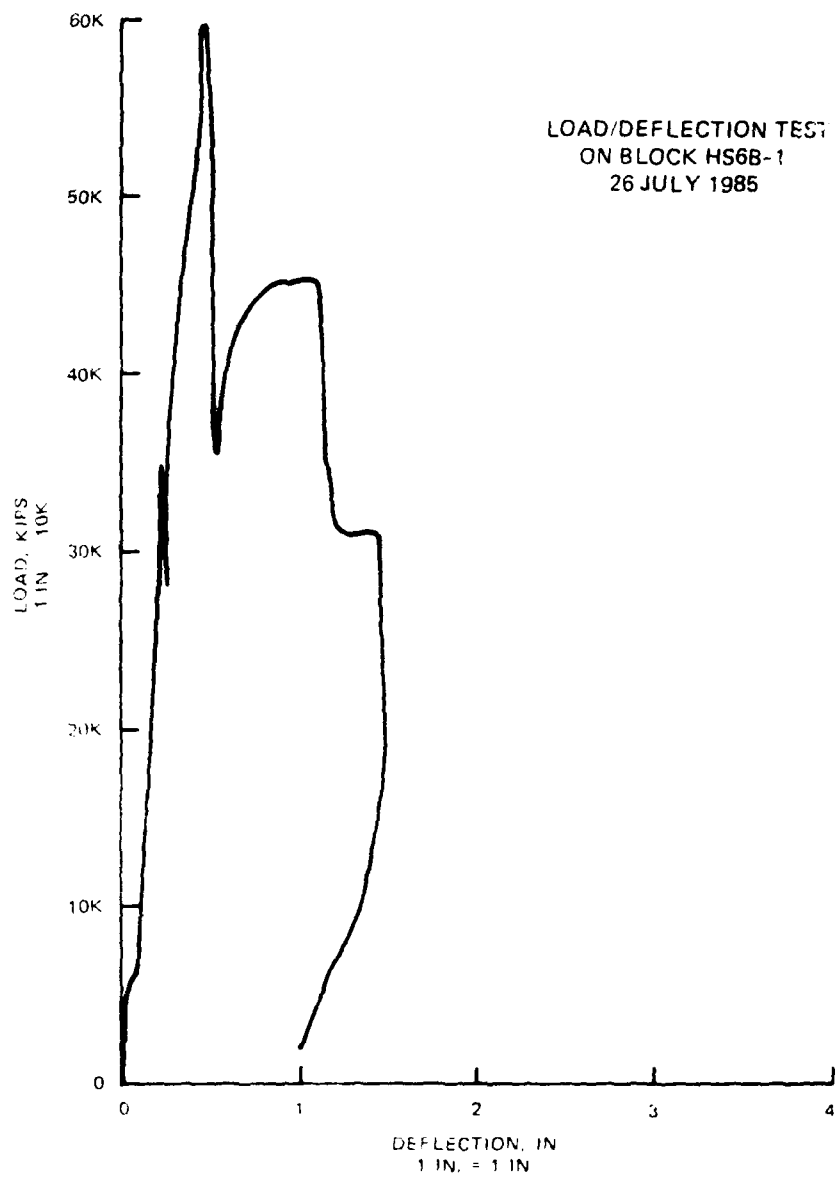


PLATE 4



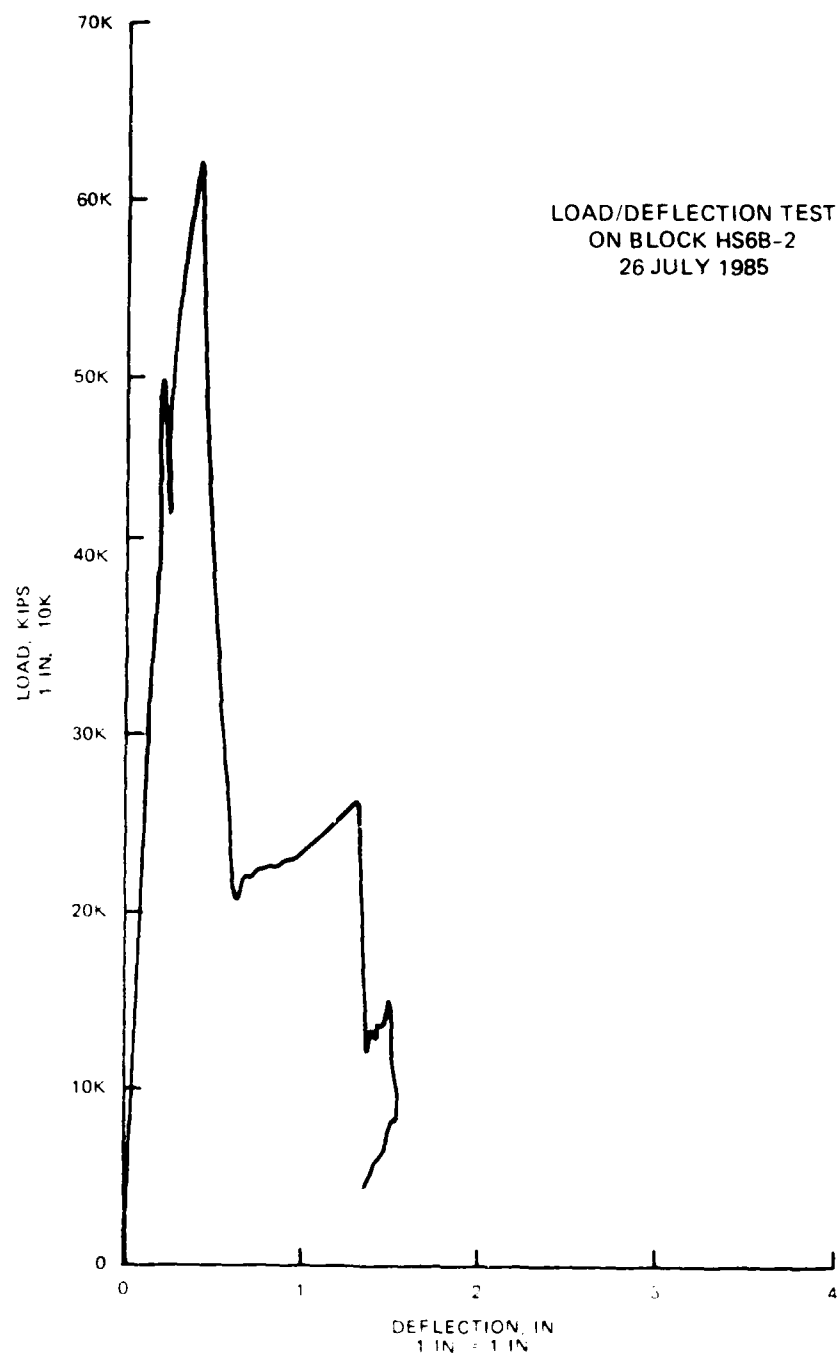
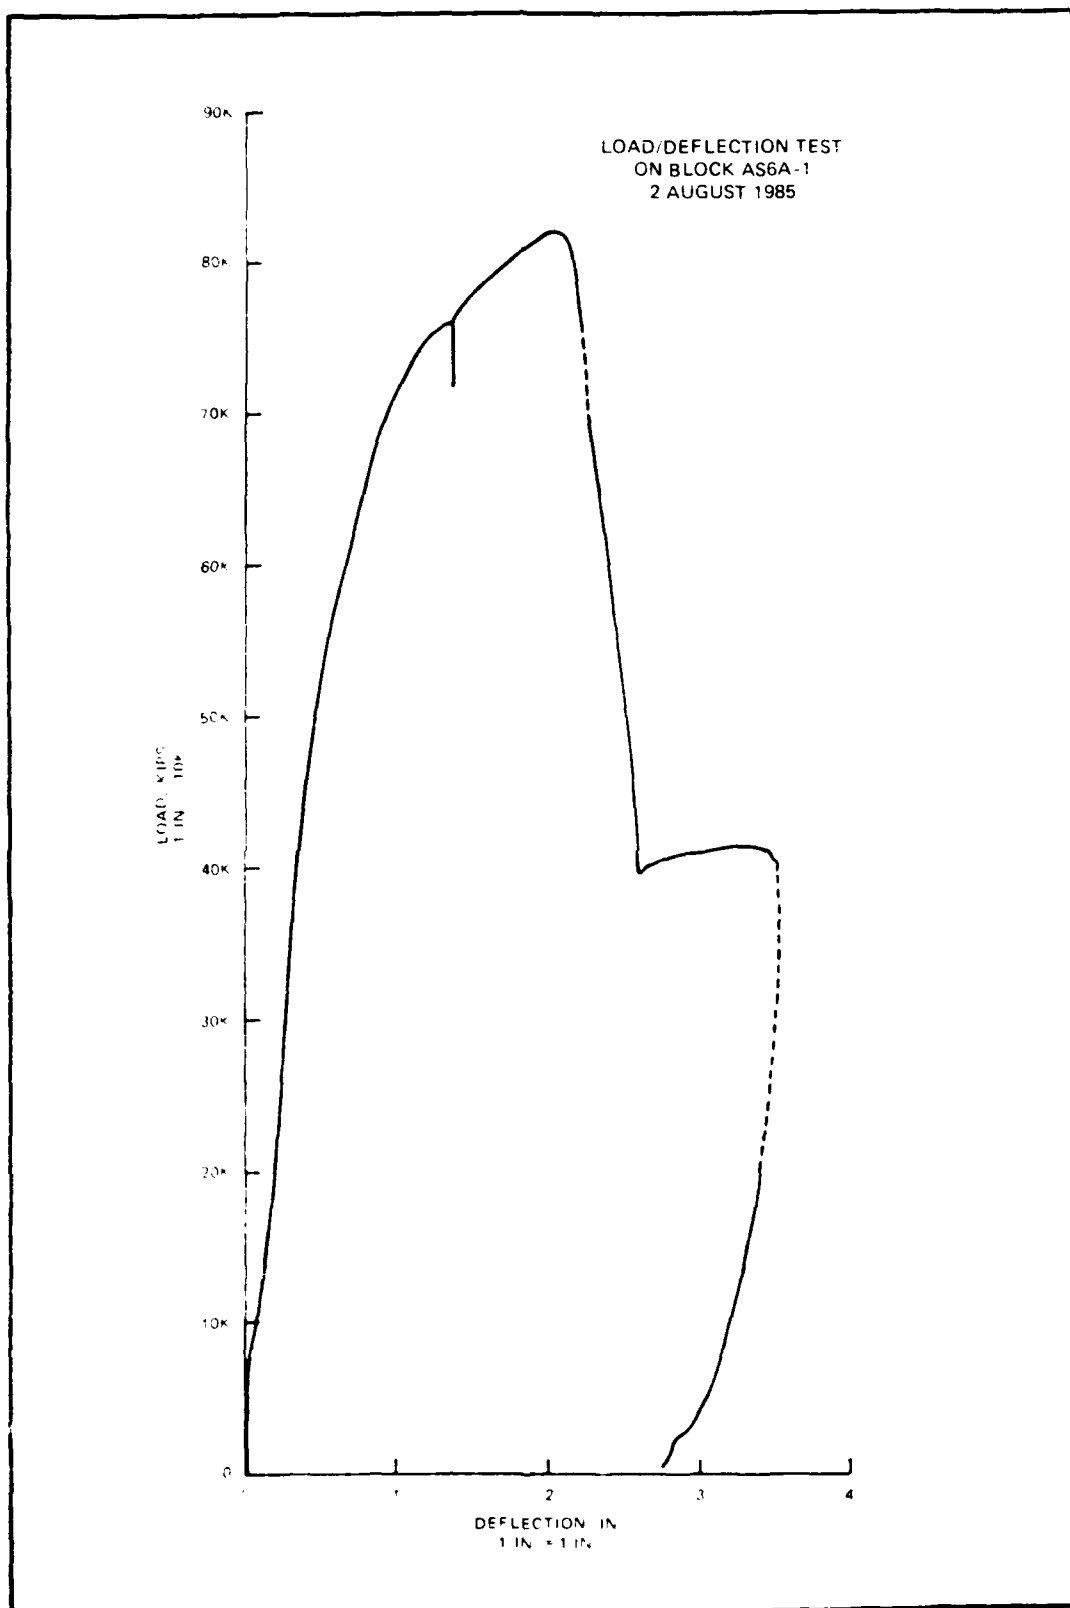


PLATE 6



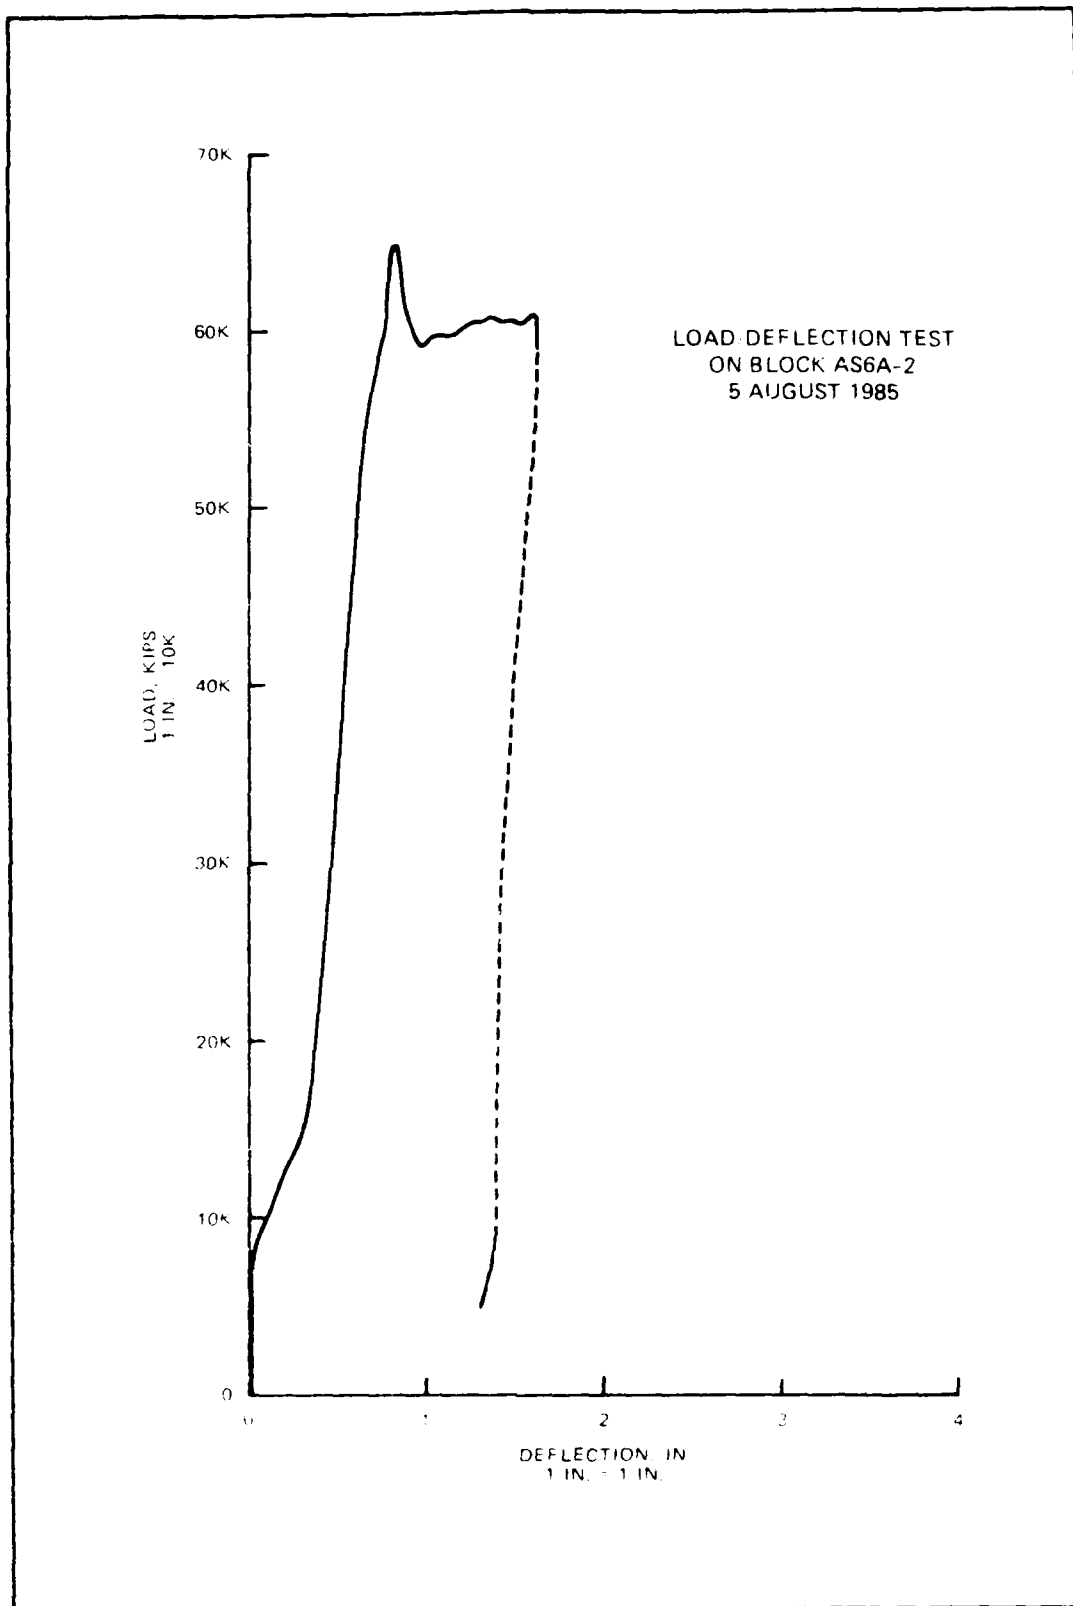
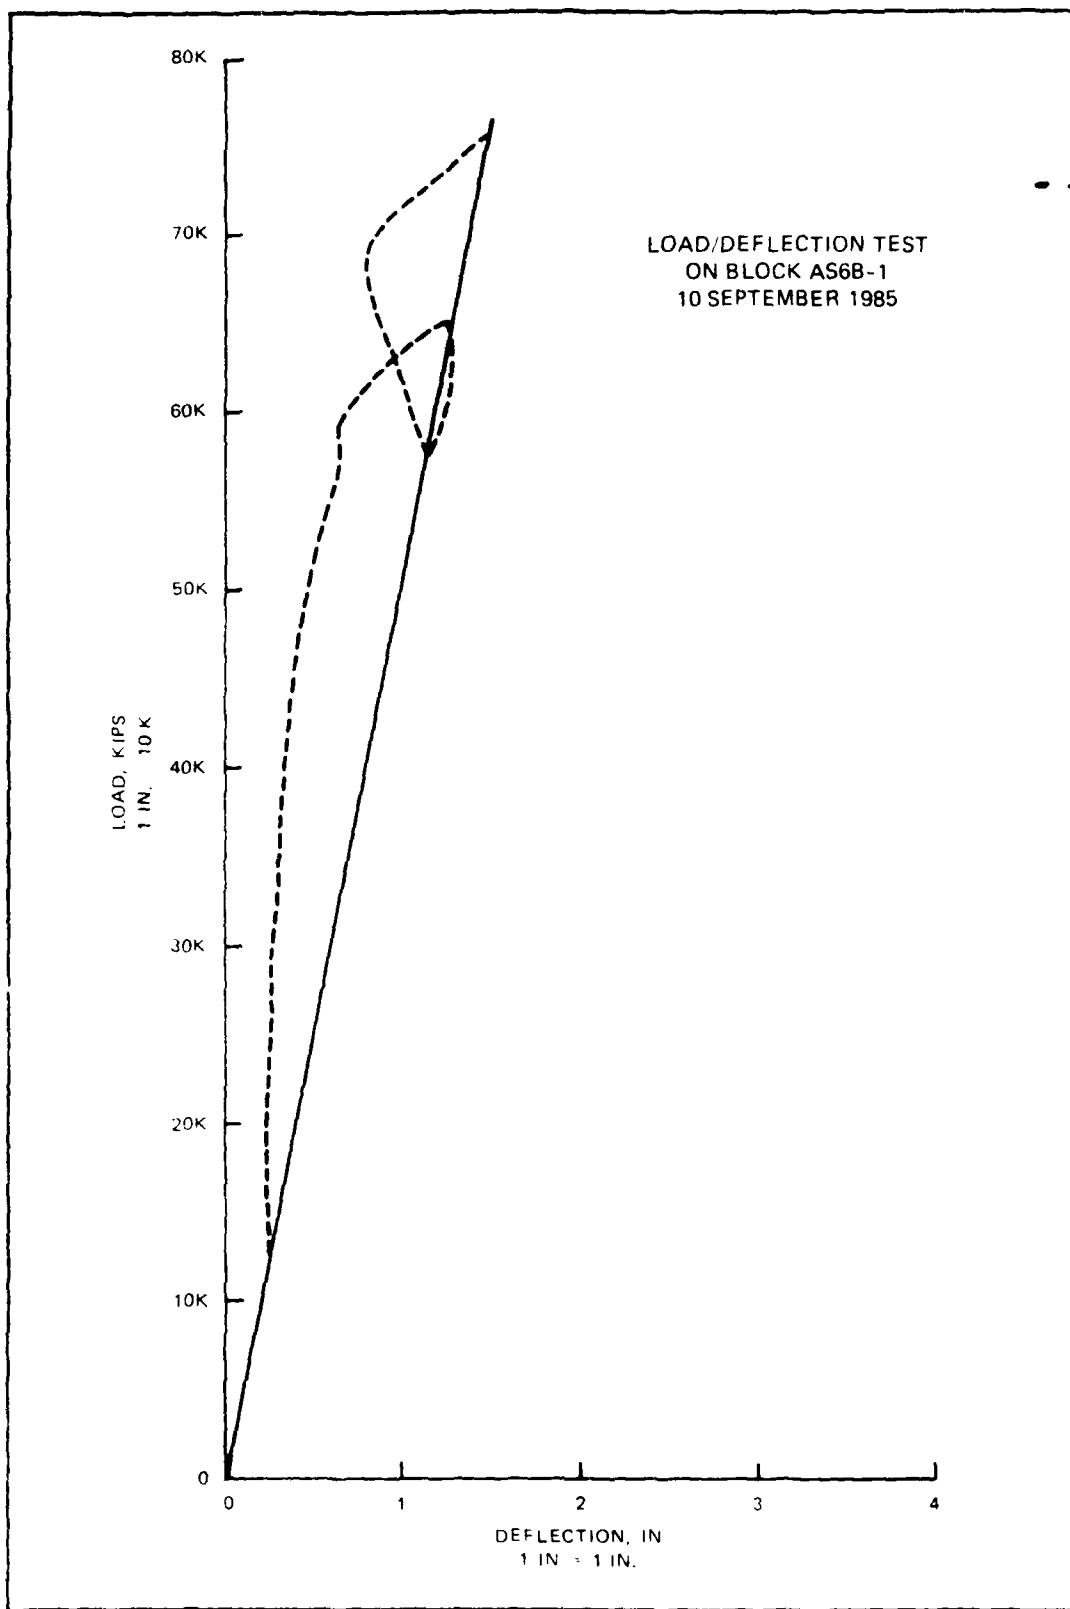


PLATE 8



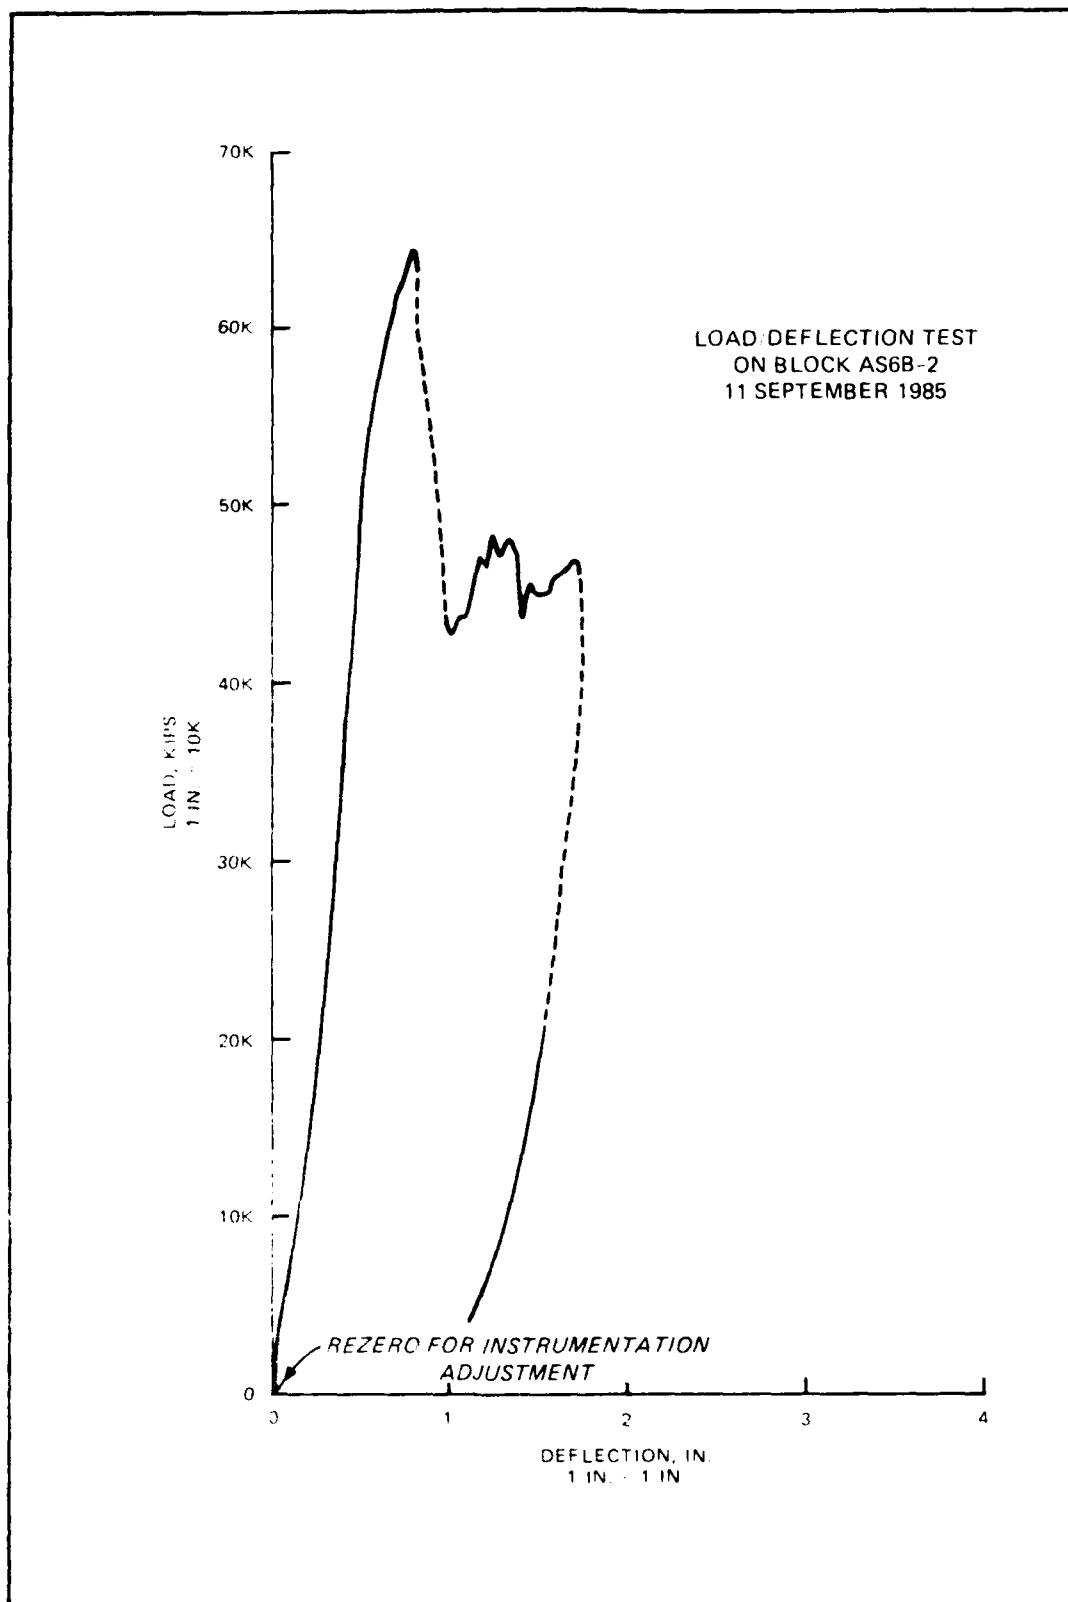
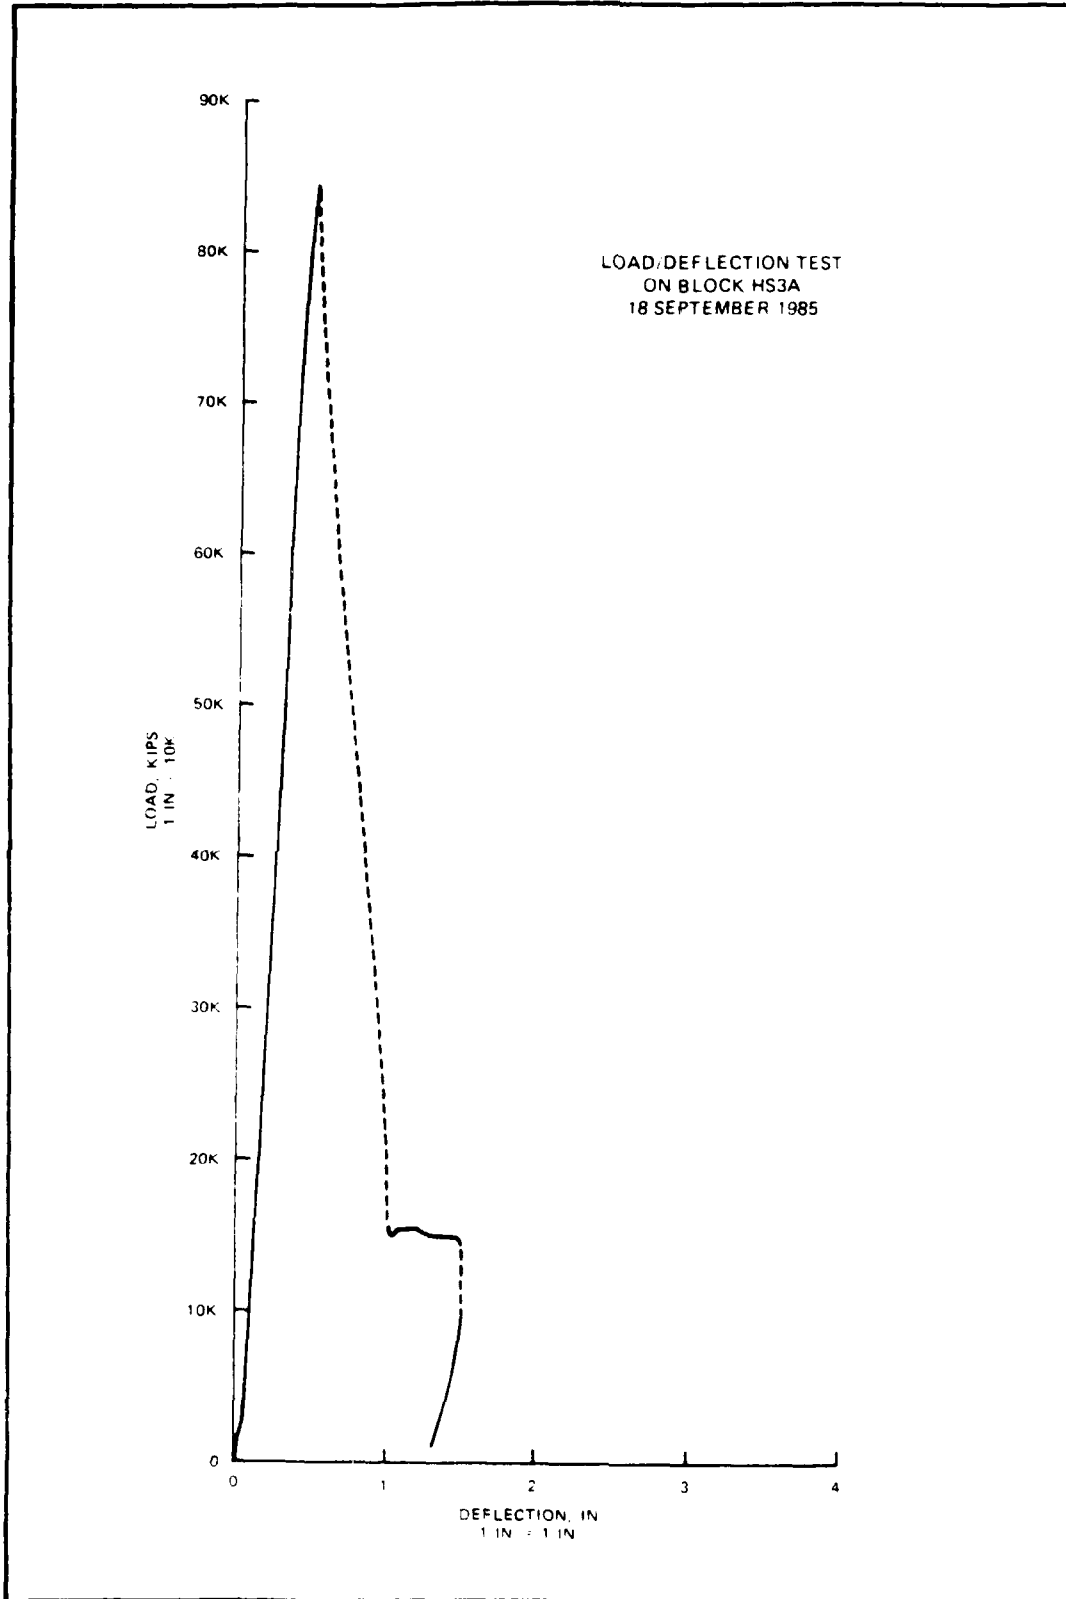


PLATE 10



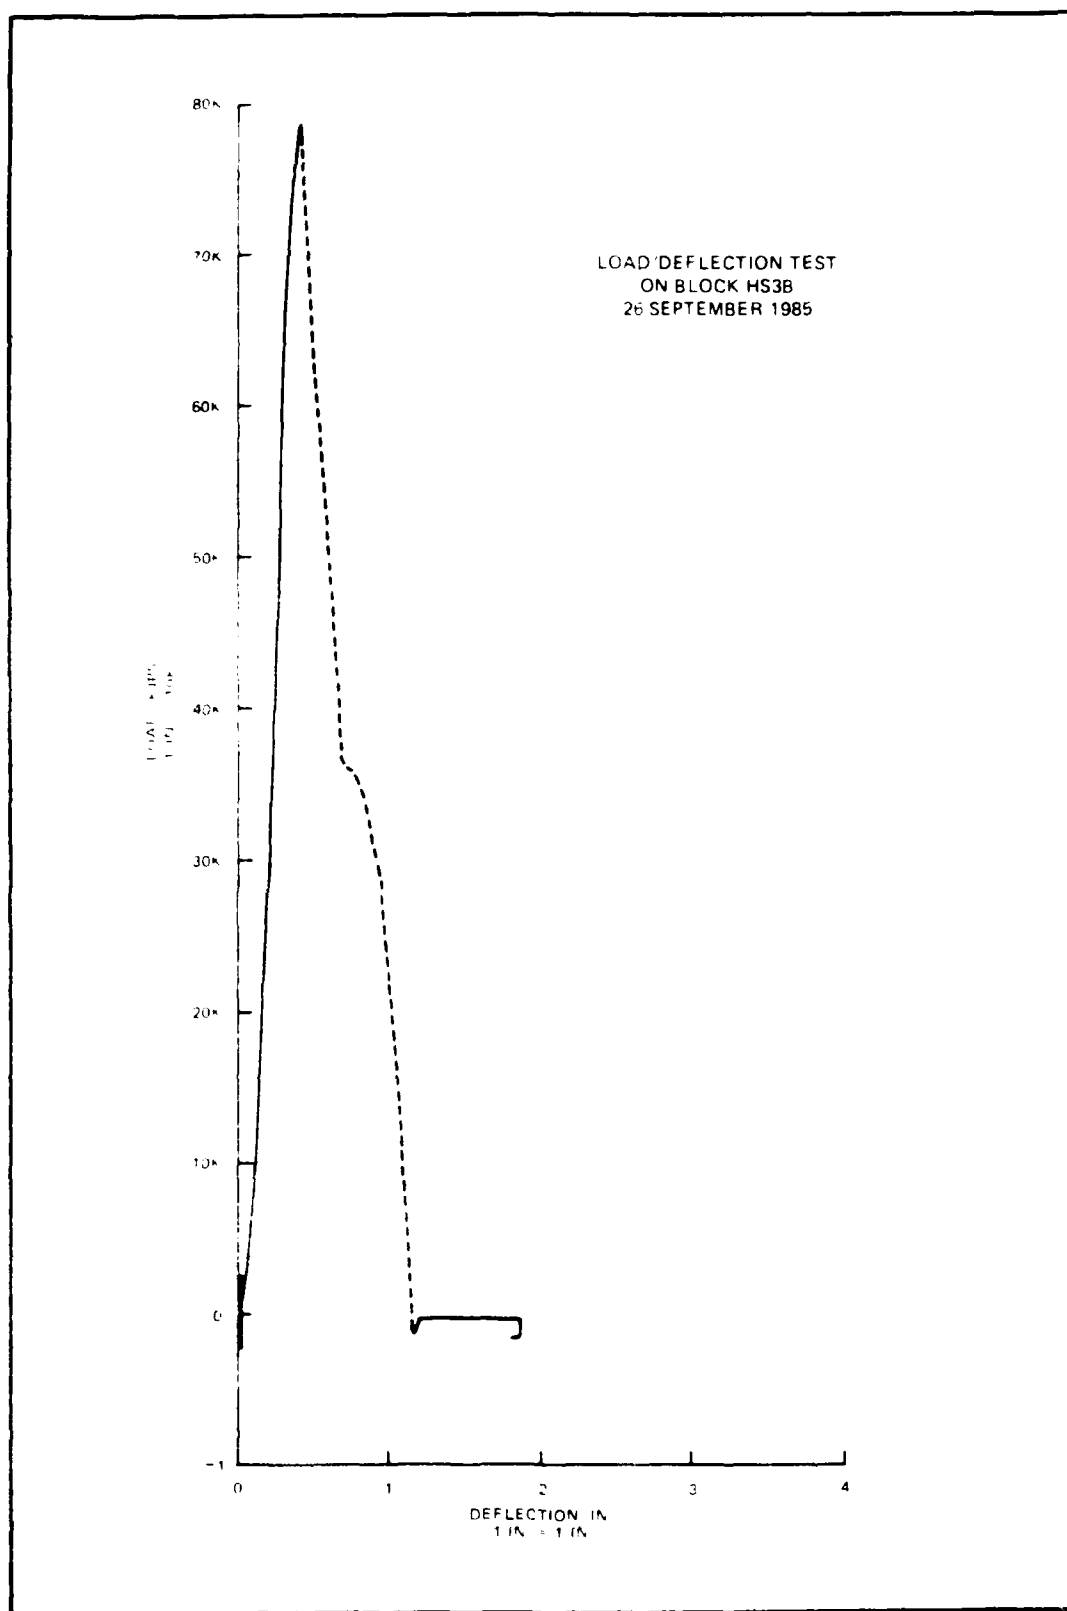
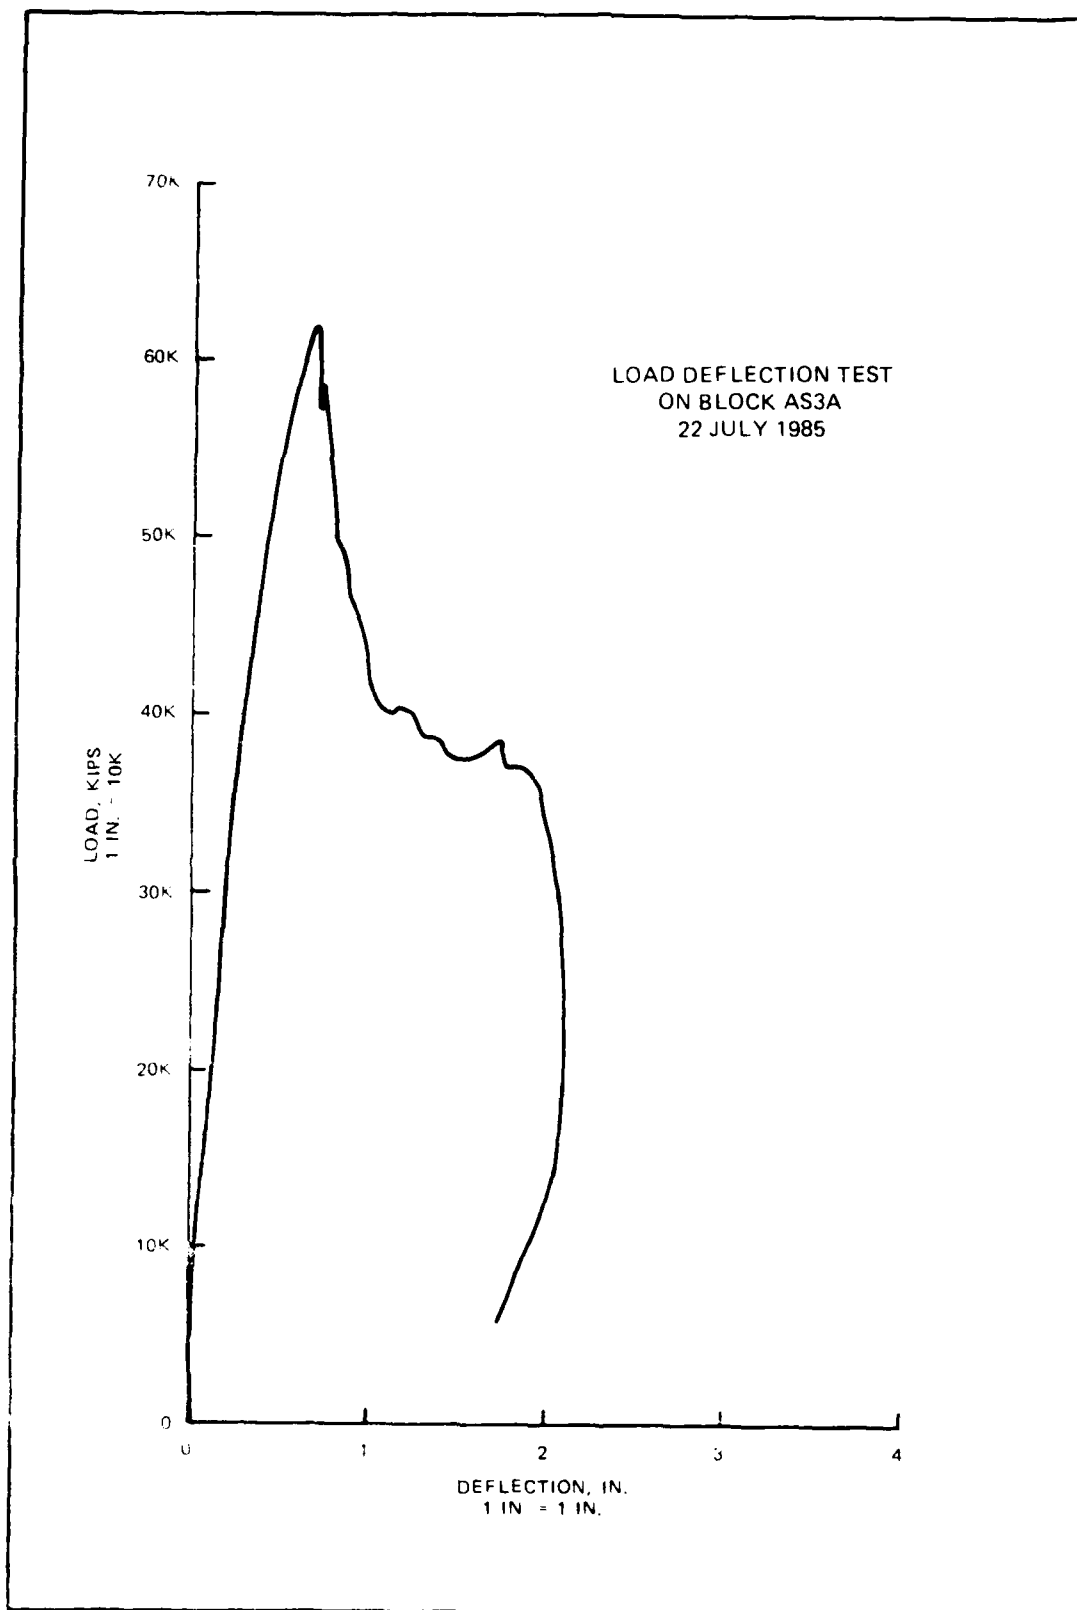


PLATE 12




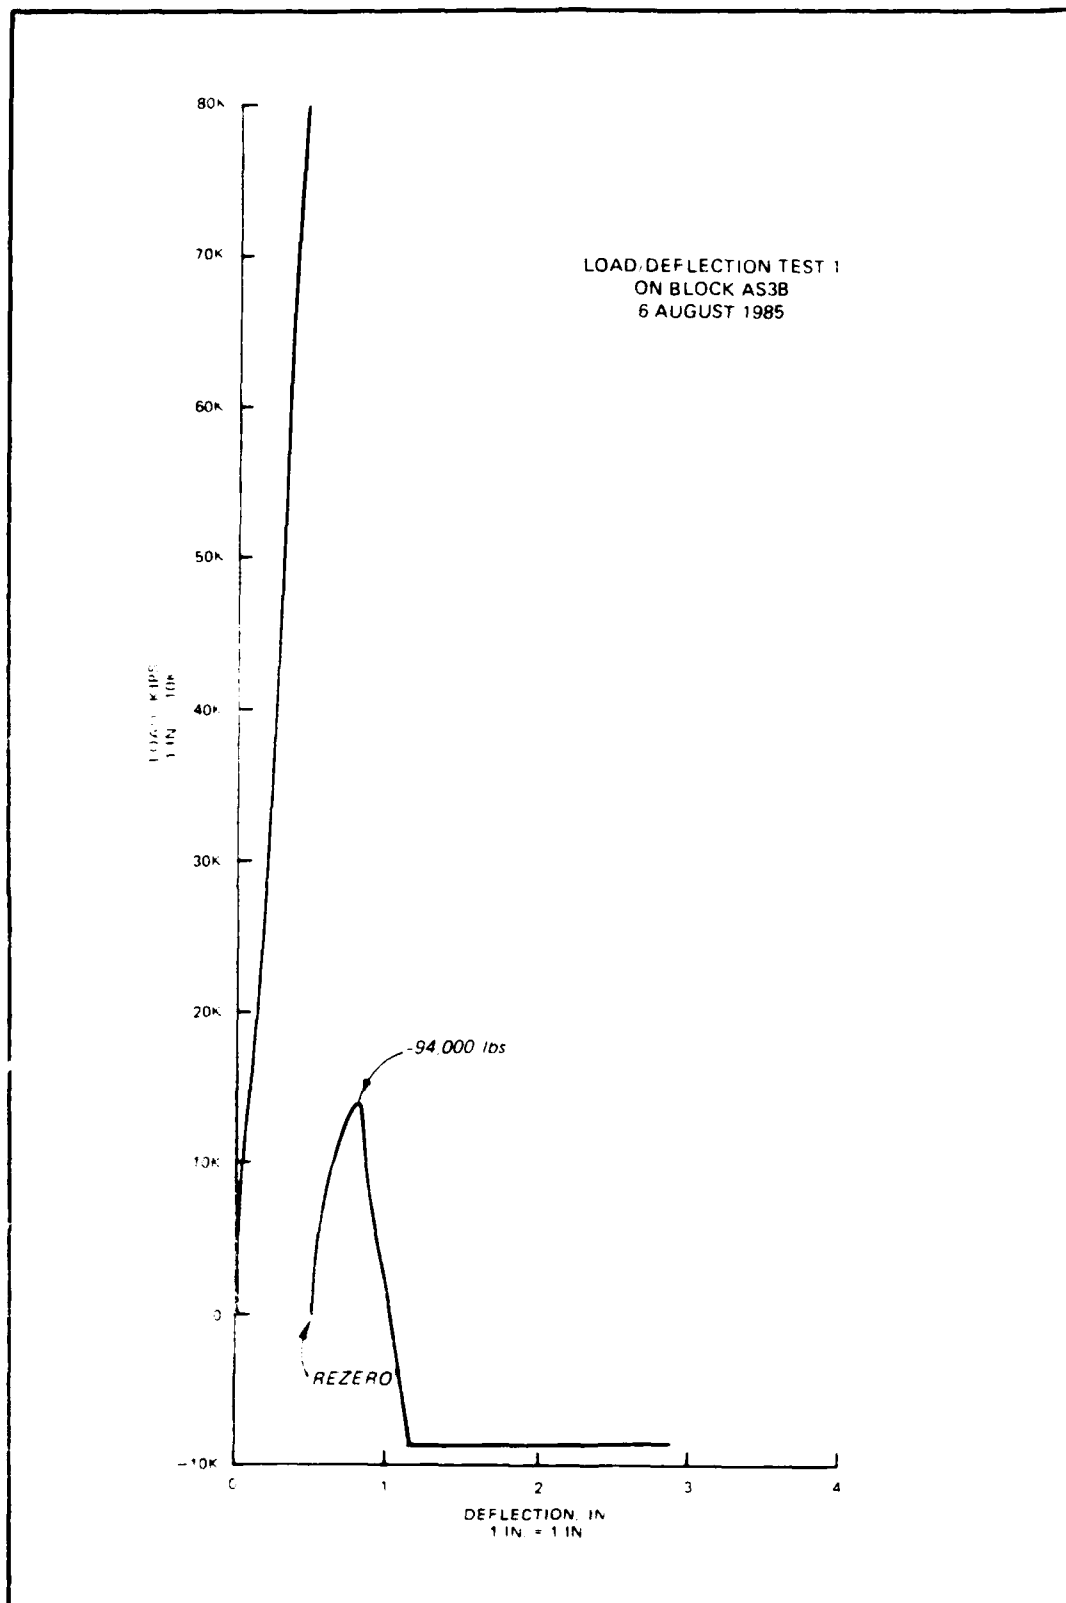


PLATE 14

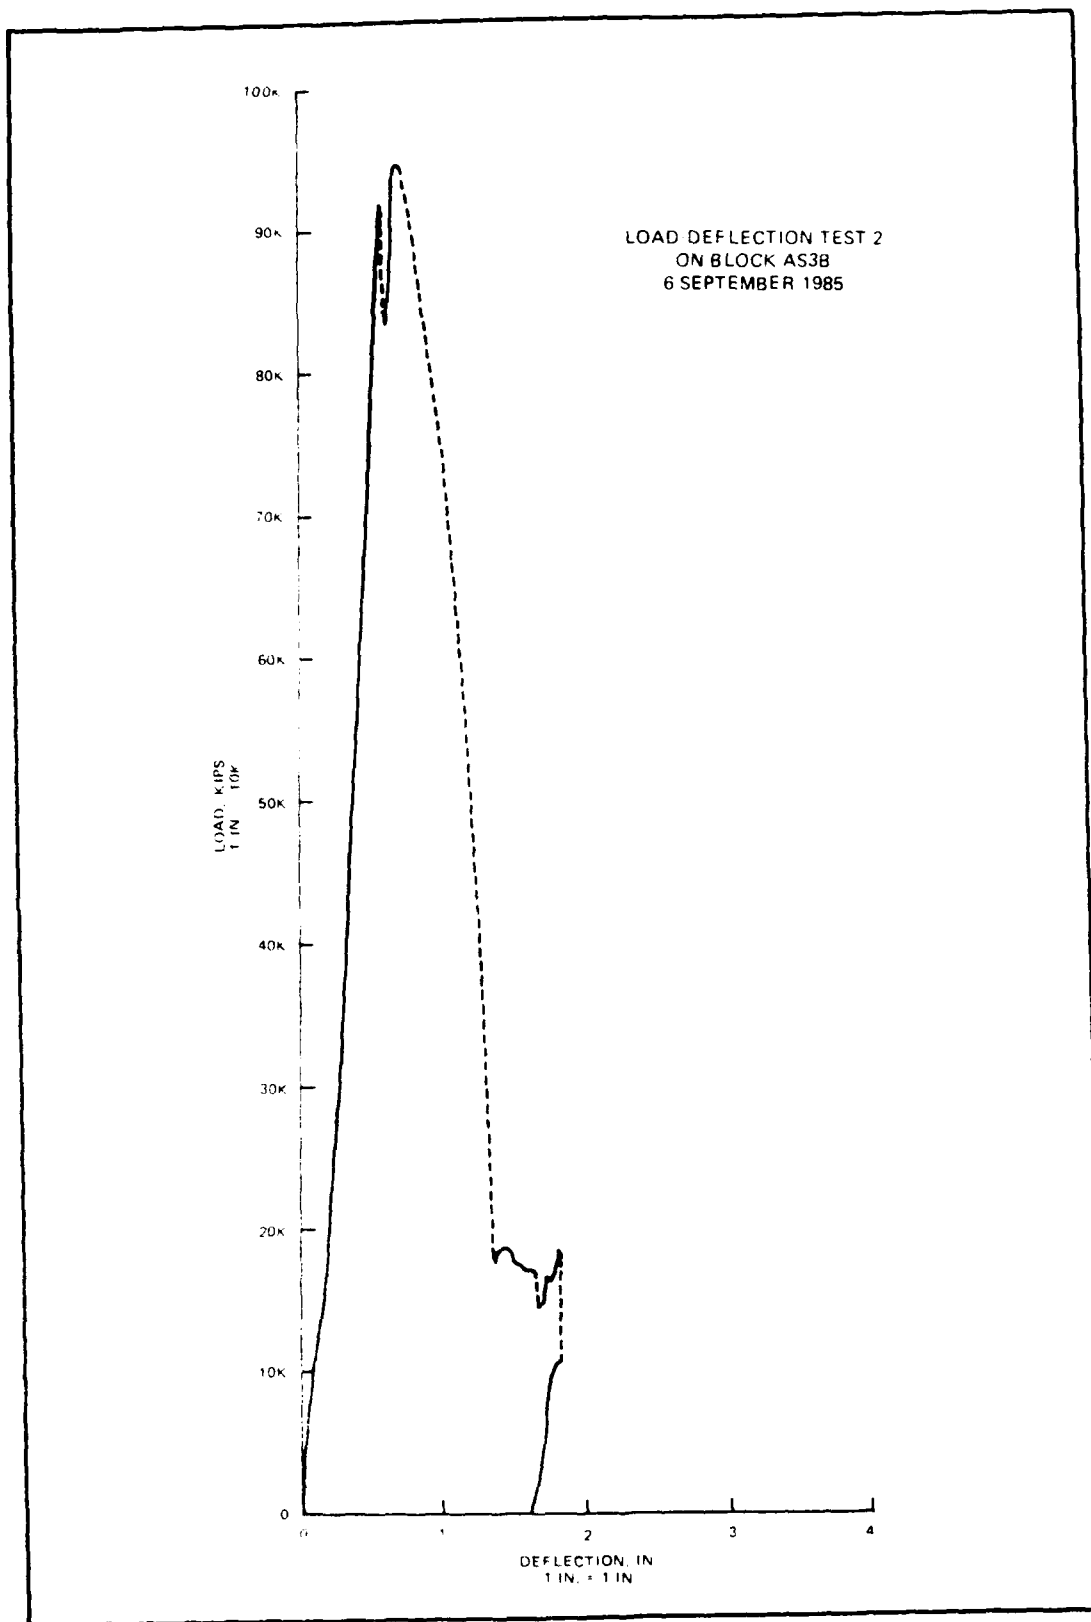

FILMED
8 8